SH 83 Safety and Operations Analysis: Bayou Gulch to El Paso County Line MP 30.20 – MP 53.88 Project Code 23008

Appendix J – Access Management Plan

Prepared for:





Prepared by:



	ı	1		I	7/13/20	T	1	Existing Access Permit	
Access ID No.	Mile	Side	Description	Existing Configuration	Proposed Configuration	Conditions for implementation		Existing Access Fermit	Issued
Access ID No.	Post	Olde	Безоприоп	Existing configuration	Troposed configuration	Conditions for implementation	(Y/N)	Number	(Year)
1e	30.24	R	Palmer Divide Ave.	Signalized Full Movement	Roundabout	Current Span Wire signal - A roundabout is currently in design which will provide the full movment operation without use of a traffic signal.	N		
1w	30.24	L	Palmer Divide Ave.	Signalized Full Movement	Roundabout	Current Span Wire signal - A roundabout is currently in design which will provide the full movment operation without use of a traffic signal.	Y	199014 + 102006	2002
2	30.50	R	E. Granada Dr	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
3	30.78	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
4	31.22	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
5	31.29	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
6	31.41	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Recommended to be closed for non-field access purposes. Parcel can be accessed through other locations.	N		
7	31.45	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	104022	2004
8	31.68	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	115069	2015
9e	31.89	R	Lorraine Rd	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues. Recommended to add a north bound left turn lane to access Lorraine Rd.	N		
9w	31.89	L	Arfsten Rd	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
10	32.22	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
11	32.30	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues. If the roadway is redeveloped along existing Douglas County ROW, access point may be relocated to provide access to multiple parcels.	Y	186065	1986
12	32.51	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
13	32.61	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
14e	32.78	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
14w	32.78	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
15	33.37	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		

1	I	1		I	//13/20 	1		Existing Access Permit	
Access ID No.	Mile Post	Side	Description	Existing Configuration	Proposed Configuration	Conditions for implementation	(Y/N)	Number	Issued (Year)
16	33.47	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
17e	33.68	R	E Best Rd	Unsignalized Full Movement	Potentially Signalized Full Movement	A signal may be implemented if and when warranted per current MUTCD standards. Once a signal is warranted and until such time as it is constructed, movements may be restricted if operational or safety issues develop.	N		
17w	33.68	L	E Jones Rd	Unsignalized Full Movement	Potentially Signalized Full Movement	A signal may be implemented if and when warranted per current MUTCD standards. Once a signal is warranted and until such time as it is constructed, movements may be restricted if operational or safety issues develop.	N		
18	33.71	R	Unofficial Park N Ride	Unsignalized Full Movement	Access to be Closed with Redevelopment	This private access is located too close to a potential signalized location and is a redundant access to the parcel and will be reduced to the access on Jones road.	N		
19	33.74	R	Unofficial Park-N-Ride	Unsignalized Full Movement	Access to be Closed with Redevelopment	This private access is located too close to a potential signalized location and is a redundant access to the parcel and will be reduced to the access on Jones road.	N		
20	33.87	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
21	33.96	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	100053 + 113032	2013
22	34.20	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	122002 + 122003	2022
23	34.37	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	113003	2013
24	34.48	L	Private Drive/Field Access	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	111068 + 112005	2012
25	34.54	L	Field Access	Unsignalized Full Movement	Combine Adjacent Access Points	Combine access point with the permitted access point number 24. Recommended to align with access 26.	N		
26	34.55	R	Private Drive	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations. Recommended to realign with future combined 24/25 access.	N		
27e	34.65	R	Riley Dr.	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	189091	1989
27w	34.65	L	Private Drive	No Drive Present	Access to be Closed with Redevelopment	This private access permit was never developed and is not physically in the location. The permit indicates the location that was intended for development and has since expired.	E	106043	2006 (Expired)
28	34.81	R	Elliot Dr.	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	197046	1997
29	34.82	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
30	35.02	R	Shared Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Υ	193023	1993
31	35.28	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
				J G	· ·	movements as needed to address safety or operational issues.			


l l					1			Existing Access Permit	
Access ID No.	Mile Post	Side	Description	Existing Configuration	Proposed Configuration	Conditions for implementation	(Y/N)	Number	Issued (Year)
32	35.77	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues. Recommended to align with access point 33.	N		
33	35.78	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues. Recommended to realign with access point 32.	N		
34	36.04	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	100073	2000
35	36.10	R	Private Drive	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	Y	118008	2018
36	36.28	R	Private Drive	Unsignalized Full Movement	Access to be Closed with Redevelopment	Access is redundant to the parcel and will be reduced to using the permitted access point number 35.	N		
37	36.31	L	E Greenland Rd	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
38e	36.36	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
38w	36.36	L	Field Access	Unsignalized Full Movement	Access to be Closed with Redevelopment	Access is redundant to the parcel and will be reduced to using the access point along Greenland road.	N		
39	36.46	L	Private Drive (Cherry Valley Fire Station)	Unsignalized Full Movement	Potentially Signalized Full Movement	Full movement access contingent upon emergency vehicle purposes only.	N		
40	36.50	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	105007	2005
41	36.64	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
42	36.72	L	Private Drive - Shared	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	104023	2004
43	36.88	R	Private Drive - Shared	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	196008 + 102083	2002
44	37.24	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
45	37.25	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
46e	37.57	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
46w	37.57	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
47	37.80	R	Gillian Ave	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues. Recommended to add south bound left turn lane to access Gillian Ave and a South bound acceleration lane for the west bound left turn movement.	Y	102060	2002

	ı	1 1	I	I	//15/20	/ 	I	Existing Access Permit	
Access ID No.	Mile Post	Side	Description	Existing Configuration	Proposed Configuration	Conditions for implementation	(Y/N)	Number	Issued (Year)
48	37.91	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
49	38.05	R	Private Drive (Cherry Valley Elem. School)	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
50	38.32	L	Utility / Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
51	38.35	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
52	38.68	R	Field Access	Unsignalized Full Movement	Access to be Closed with Redevelopment	Access is too close to other access points. Will be reduced and recommended that the access is taken off of Lucas Avenue.	N		
53e	38.70	R	Lucus Rd.	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
53w	38.70	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Е	199094	1999 (Expired)
54	38.97	L	Private Drive - Shared	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	197048 + 199077 + 117002	2017
55	39.25	L	Private Drive - Shared	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	115105	2015
56e	39.35	R	Filed Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
56w	39.35	L	Filed Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
57	39.50	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
58	39.52	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations. Future realignment with access 57.	N		
59	39.55	L	Private Drive	Unsignalized Full Movement	Access to be Closed with Redevelopment	Access is redundant to the parcel and will be reduced to using the access point number 57.	N		
60	39.89	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
61	39.89	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
62	40.19	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
63	40.29	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
64	40.42	R	S. Russellville Rd.	Unsignalized Full Movement	Potentially Signalized Full Movement	A signal may be implemented if and when warranted per current MUTCD standards. Once a signal is warranted and until such time as it is constructed, movements may be restricted if operational or safety issues develop.	Y	101032	2001


I	I]	//15/20	 		Existing Access Permit	
Access ID No.	Mile Post	Side	Description	Existing Configuration	Proposed Configuration	Conditions for implementation	(Y/N)	Number	Issued (Year)
65e	40.89	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
65w	40.89	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	193021 + 105006	2005
66e	41.07	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	191004	1991
66w	41.07	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
67e	41.27	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
67w	41.27	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
68	41.75	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	192054	1992
69e	41.86	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
69w	41.86	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
70	41.94	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
71	42.17	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	107071	2007
72	42.32	L	Unofficial Park-N-Ride	Unsignalized Full Movement	Remove Illegal Access Point / Park and Ride	Access is located in CDOT right of way on the south end of Lake Gulch Rd. The gravel lot is considered an illegal access and shall be closed.	N		
73	42.33	L	Lake Gulch Rd	Unsignalized Full Movement	Potentially Signalized Full Movement	A signal may be implemented if and when warranted per current MUTCD standards. Once a signal is warranted and until such time as it is constructed, movements may be restricted if operational or safety issues develop.	Y	100014	2000
74	42.91	R	Field Access/Utility Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
75	43.35	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
76	43.40	L	Fox Glen Dr	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	E	194053	1994 (Expired)
77	43.72	R	Private Drive-Shared	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	186024	1986
78	43.99	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
79	43.99	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	102061	2002


1	I			l I	7/13/20	I		Existing Access Permit	
Access ID No.	Mile Post	Side	Description	Existing Configuration	Proposed Configuration	Conditions for implementation	(Y/N)	Number	Issued (Year)
80e	44.65	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
80w	44.65	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	Y	189070	1989
	45.25	С	Rest / Parking Area /Weight Station Area	Widening of road	Pull off Location / Mobile Weigh Station	Current pull off location used for mobile weigh station and check points. Widened area will remain but is not considered an access point.	N		
82e	45.70	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
82w	45.70	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	E	186075	1986 (Expired)
83	45.97	L	Castle Wood Canyon State Park Entrance	Unsignalized Full Movement	Potentially Signalized Full Movement	A signal may be implemented if and when warranted per current MUTCD standards. Once a signal is warranted and until such time as it is constructed, movements may be restricted if operational or safety issues develop. Dedicated south bound right turn and north bound Left turn are anticipated.	E	188023	1988 (Expired)
84e	46.63	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
84w	46.63	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
85	46.72	R	Steeplechase Dr	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	E	198082	1998 (Expired)
86	46.88	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	190026 + 103022	2003
87	46.90	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	Y	196027	1996
89e	47.09	R	Private Drive	Unsignalized Full Movement	Access to be Closed with Redevelopment	Access is redundant to the parcel and will be reduced to using the permitted access point number 90.	N		
89w	47.09	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
90	47.14	R	Private Drive - Shared	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	191027	1991
91e	47.19402841	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		
91w	47.19	L	E. Rim Road	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	195063	1995
92	48.05	R	Private Drive - Shared	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	N		
93	48.26	L	Private Drive - Shared	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	194045 + 100038	2000
94	48.50	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N		

					7,13,20					
	Mile	Mile					Existing Access Permit			
Access ID No.	Mile Post	Side	Description	Existing Configuration	Proposed Configuration	Conditions for implementation	(Y/N)	Number	Issued (Year)	
95	48.51	R	CDOT Stockpile Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N			
96e	49.03	R	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	Z			
96w	49.03	L	Field Access	Unsignalized Full Movement	Revise Access if Property Redevelopes	Evaluate and revise the access if property redevelopes or if there is a safety concern related to the access. Parcel can be accessed through other locations.	N			
97	49.43	R	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	196013	1996	
98	49.46	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	189001	1989	
99e	49.71	R	Field Access	Unsignalized Full Movement	Access to be Closed with Redevelopment	Access point is redundant to the parcel and will be closed. Access will be taken from permitted access point number 100.	N			
99w	49.71	L	Field Access	Unsignalized Full Movement	Access to be Closed with Redevelopment	Access point is redundant to the parcel and will be closed. Access will be taken from the main entrence off of Russellville road or off of permitted access point 92.	N			
100	49.80	L	Private Drive	Unsignalized Full Movement	Unsignalized Full Movement	Remain unsignalized provided acceptable safety and operational conditions exist. Restrict movements as needed to address safety or operational issues.	Y	199034 + 102019	2002	
101	49.88	L	Private Drive - Utilities	Unsignalized Full Movement	Combine Adjacent Access Points	When Russellville Rd becomes signalized, access point 101 is too close to the proposed signal. 101 to be closed and vehicle to enter parcel via private drive inline with Russellville Rd. Consideration of the number of maintenance vehicles should be evaluated upon revision.	Y	187069	1987	
	49.89		Russellville Rd.	Unsignalized Full Movement		Russellville Road's access is governed by the SH 83 Access Control Plan MP 49.89 - MP 63.06.				

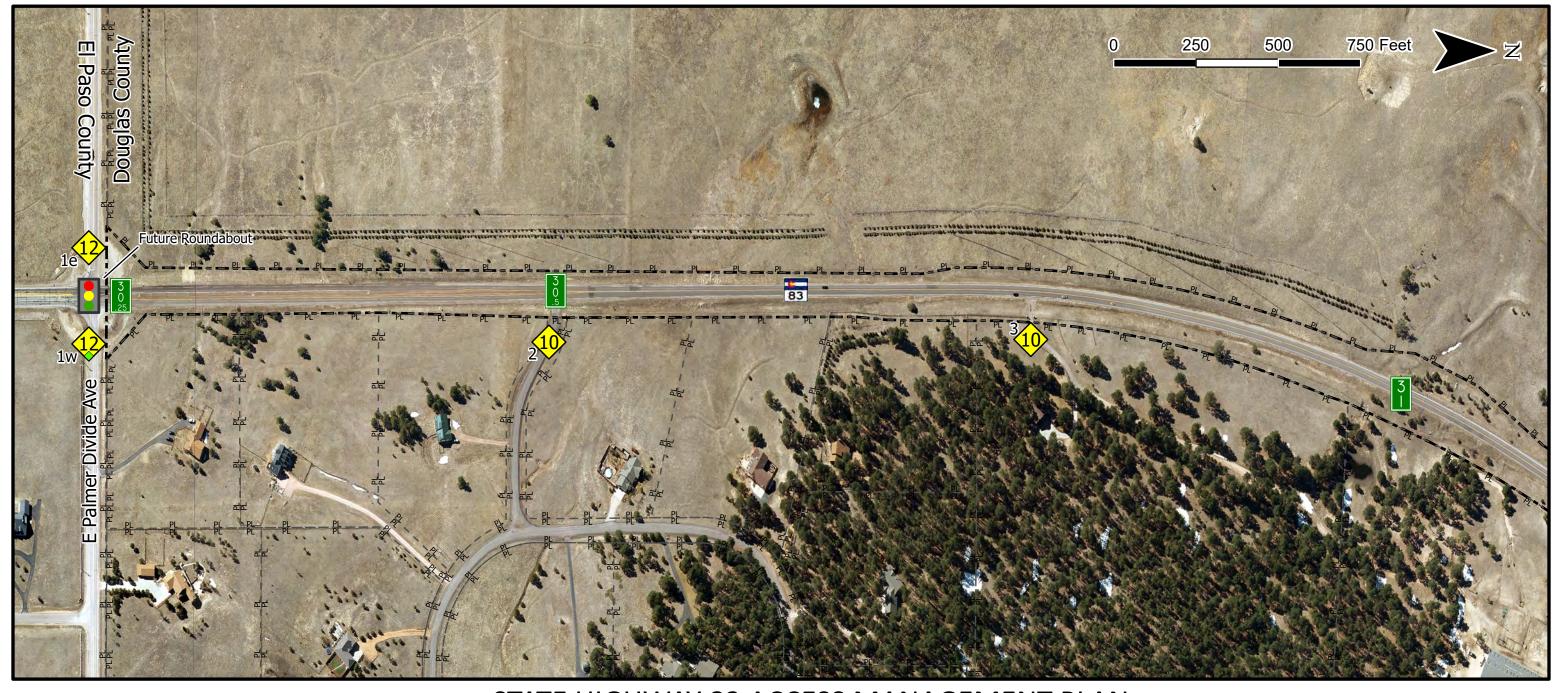



Sheet 1 of 26

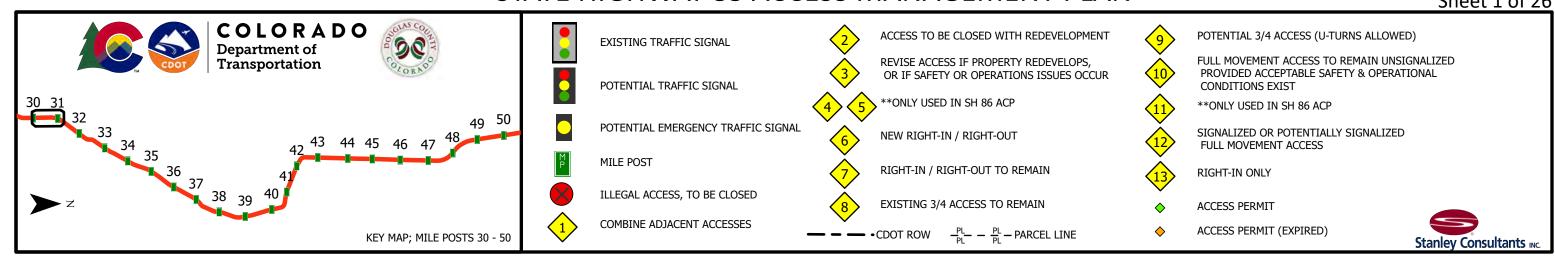

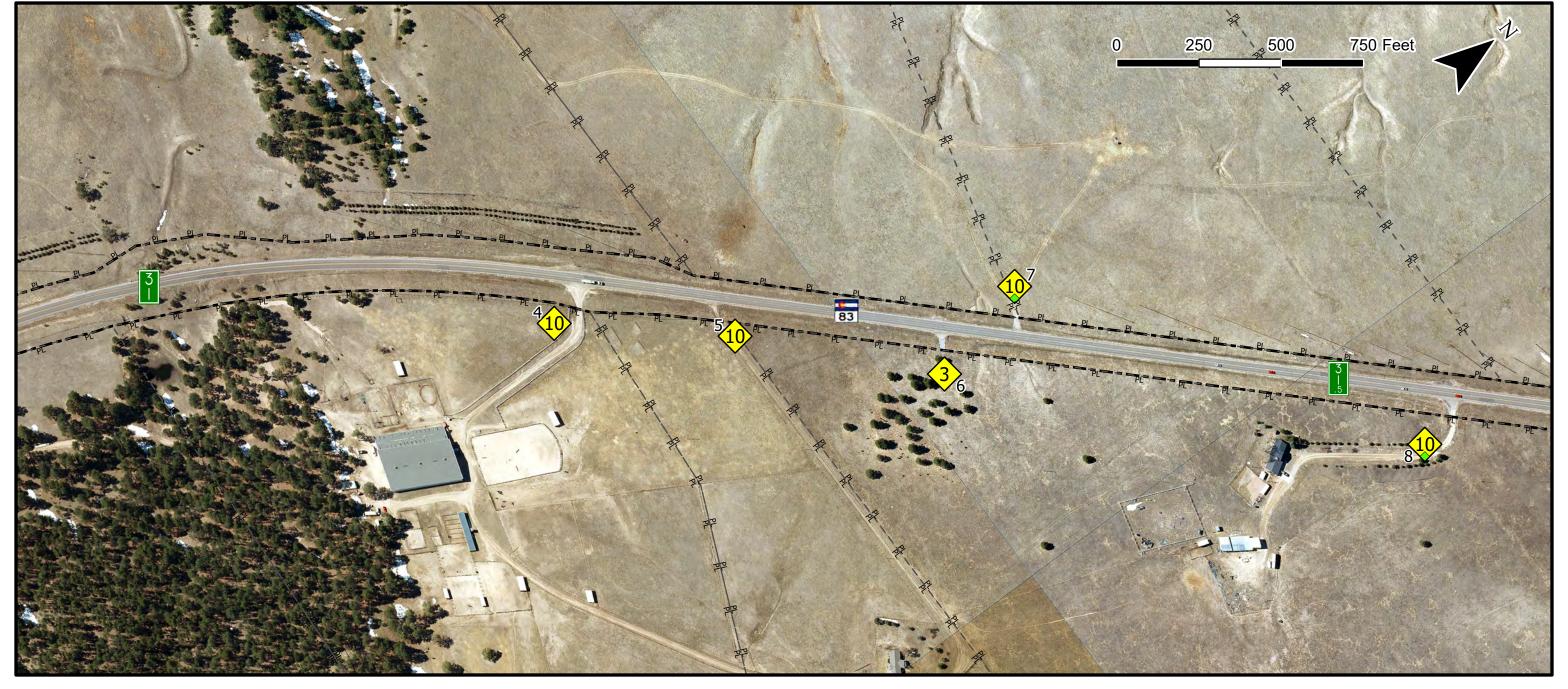



Sheet 2 of 26

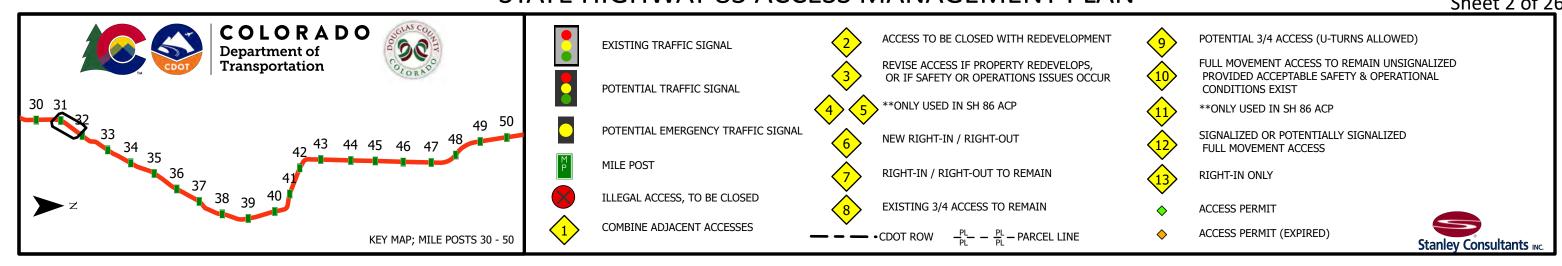

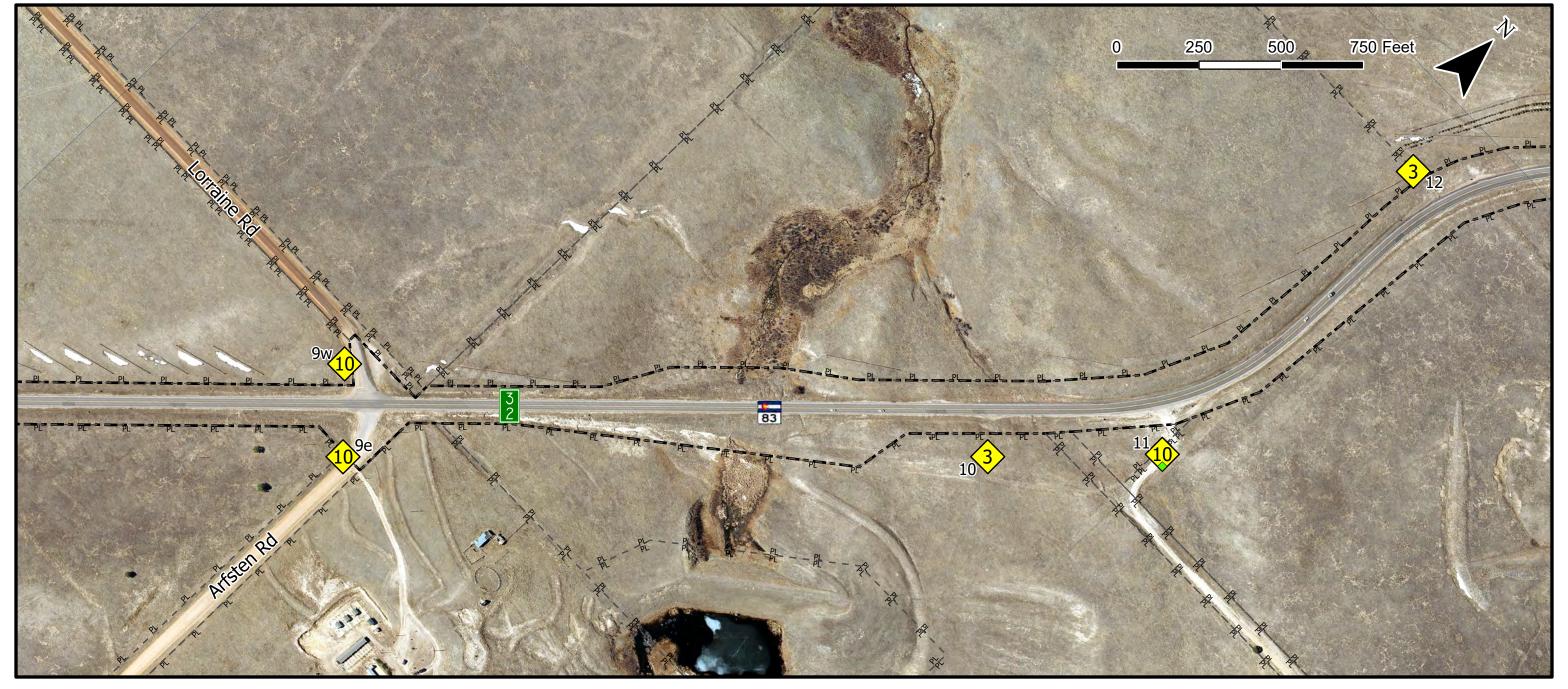



Sheet 3 of 26

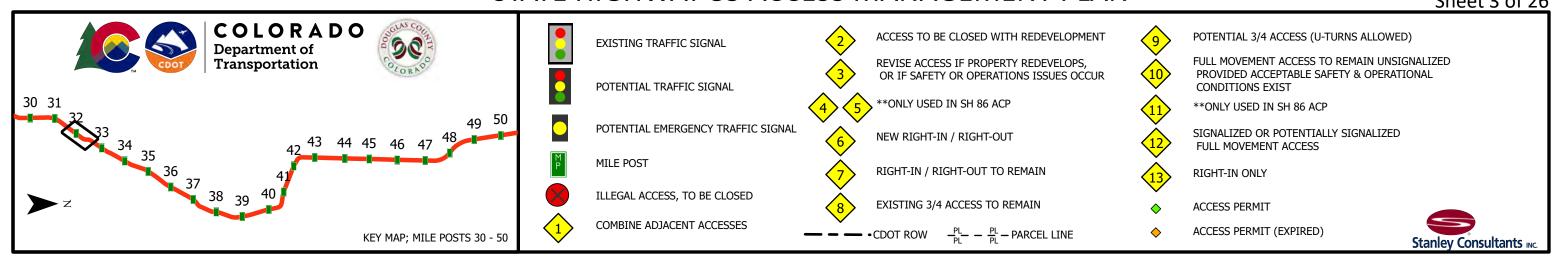

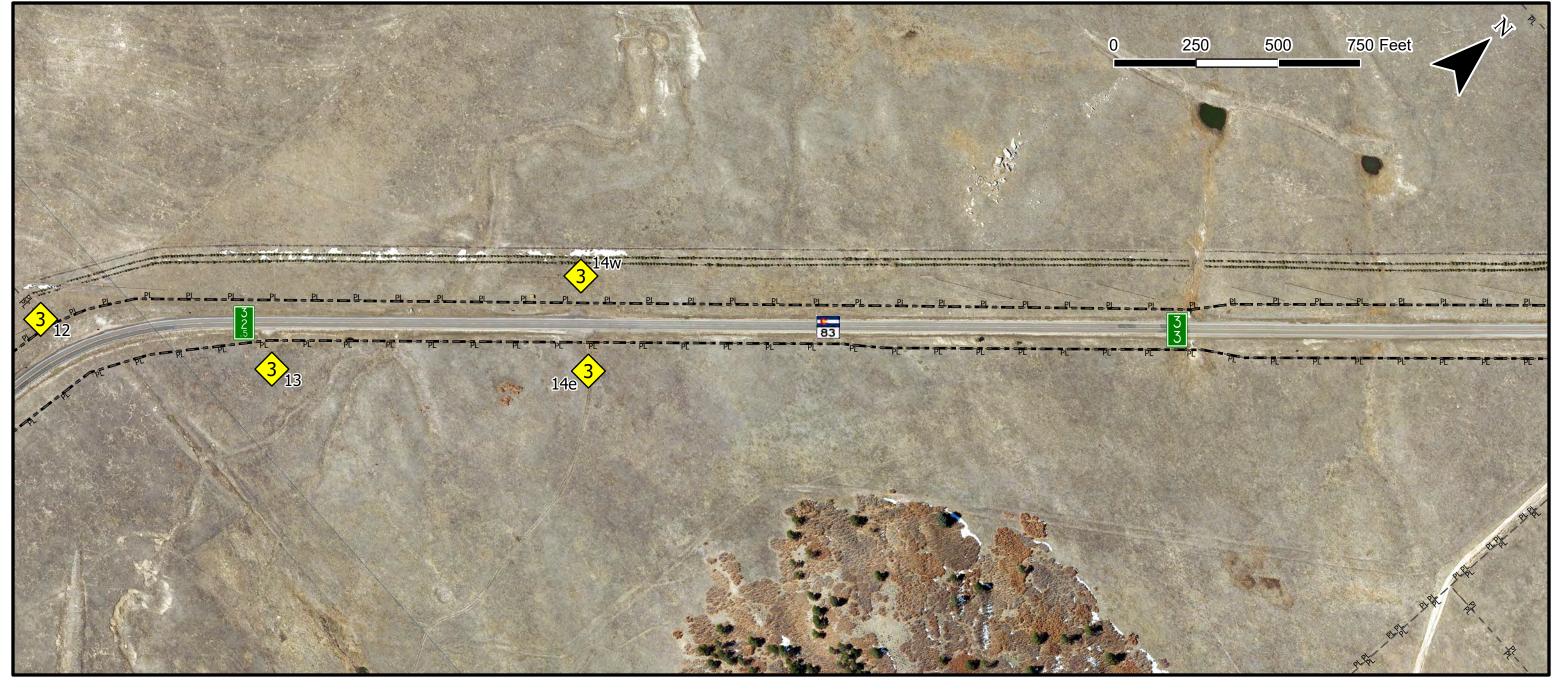



Sheet 4 of 26

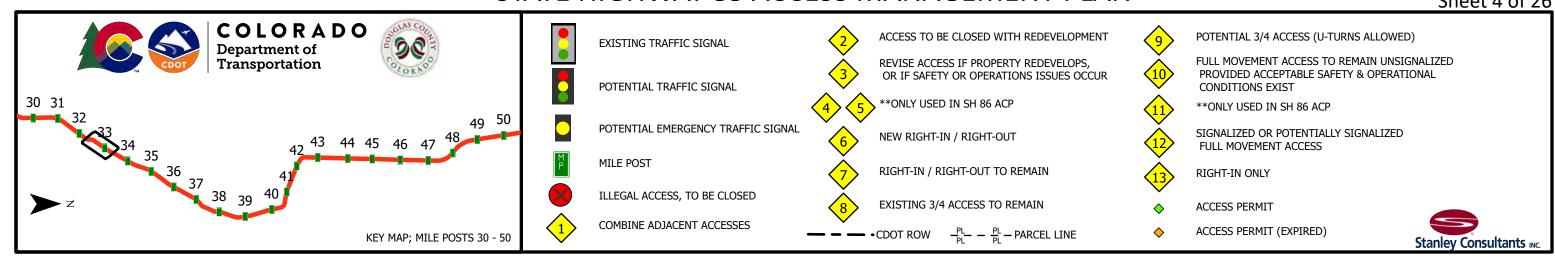

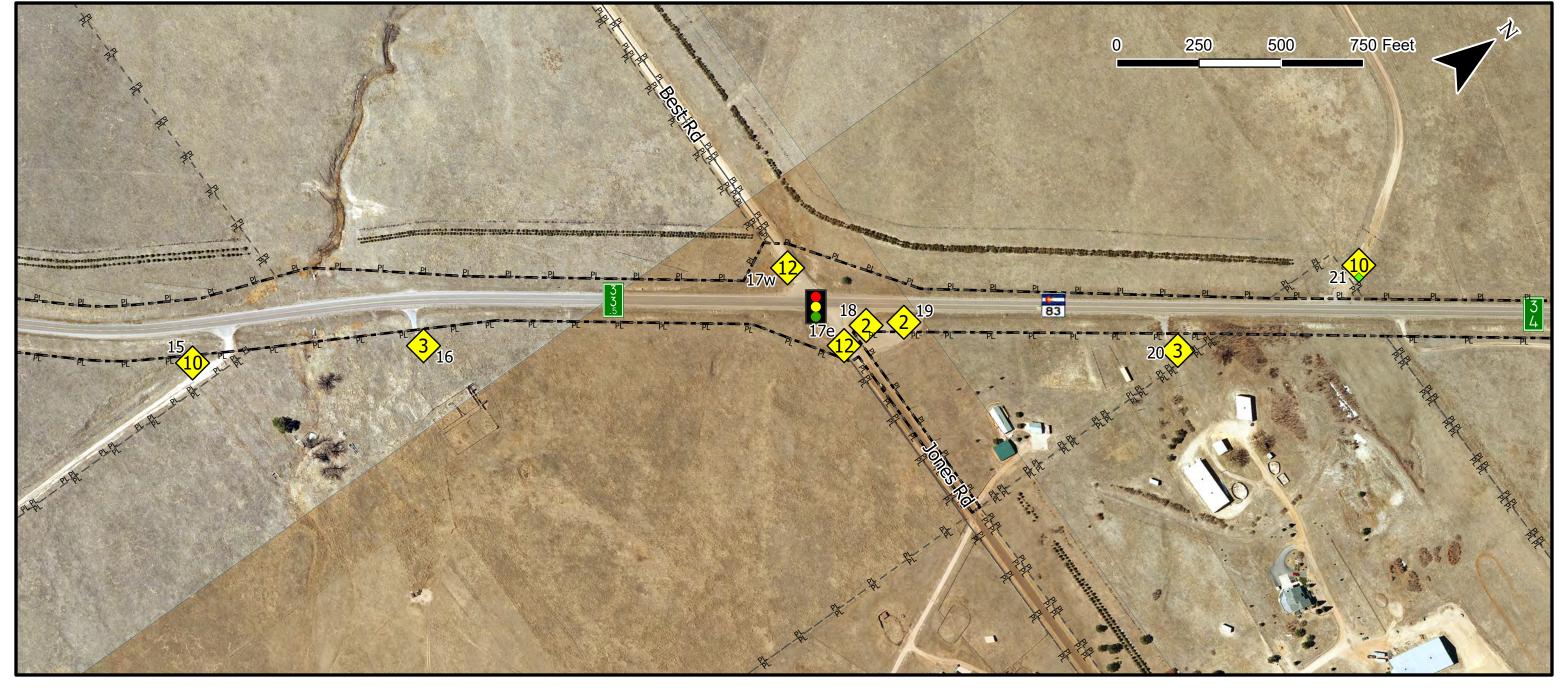



Sheet 5 of 26

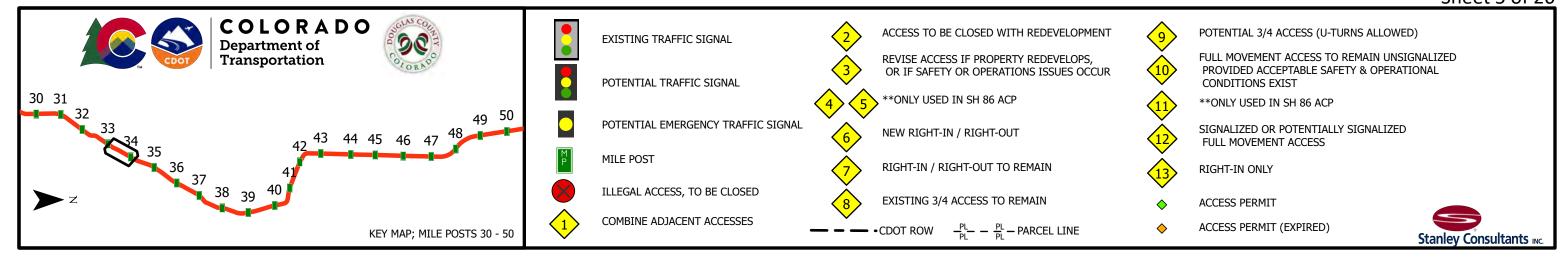

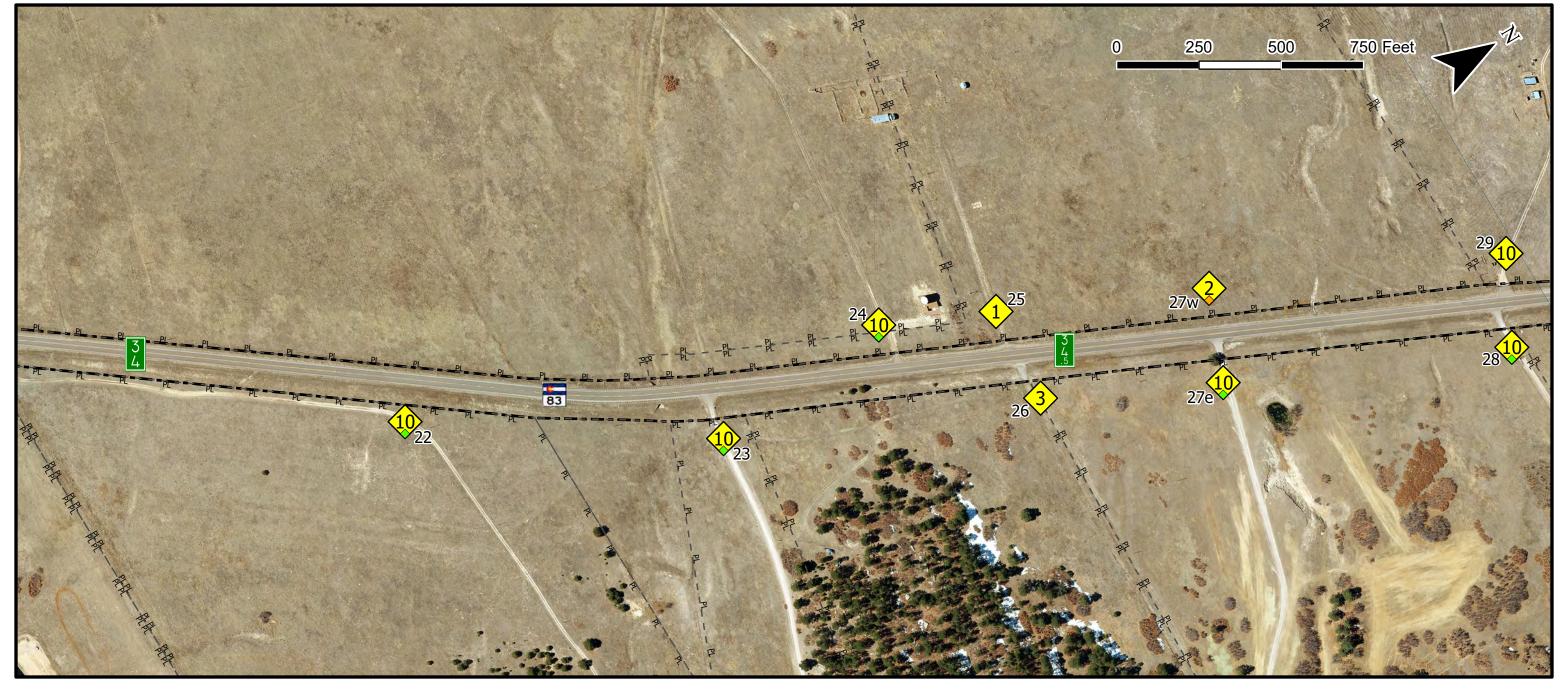


Sheet 6 of 26

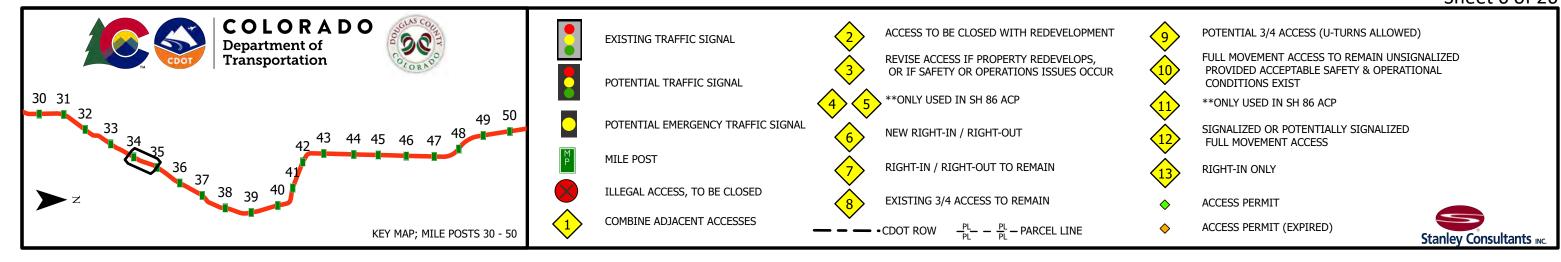

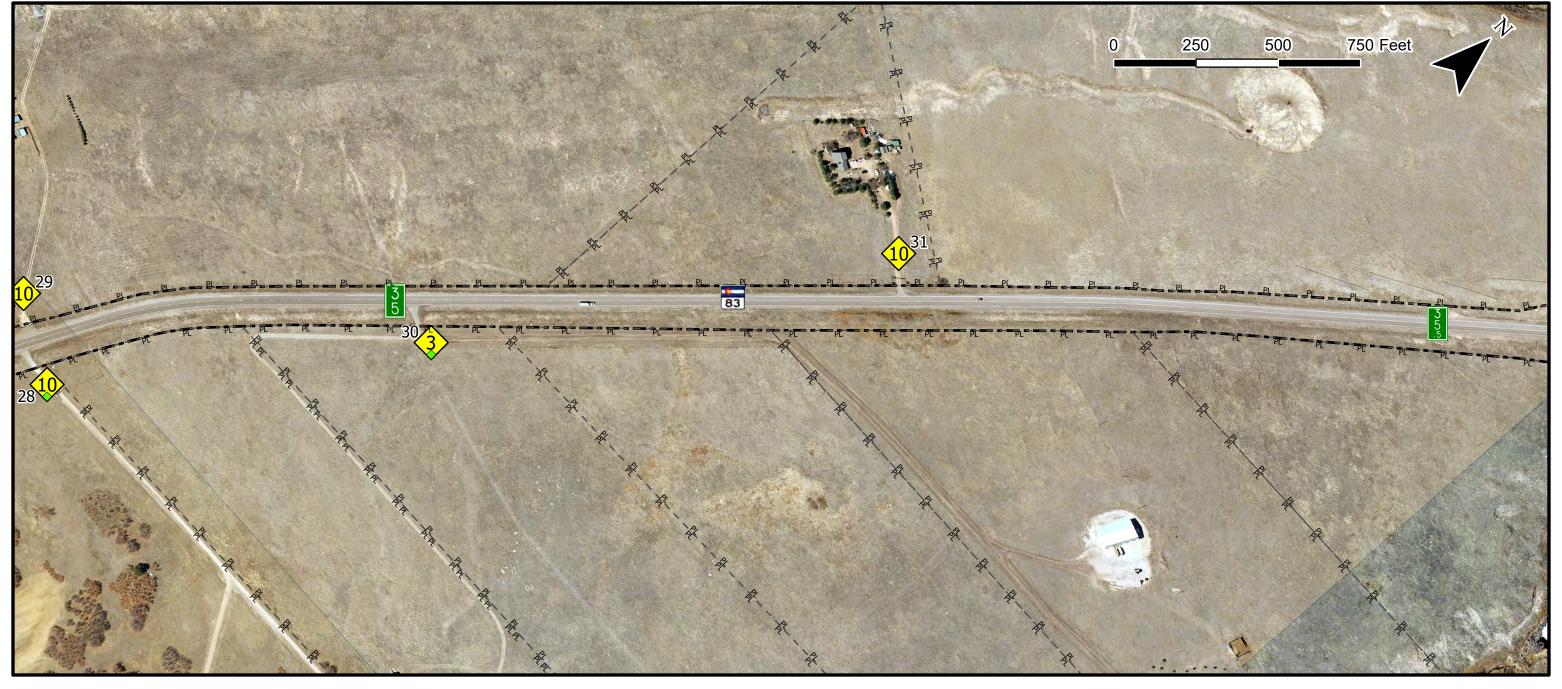



Sheet 7 of 26

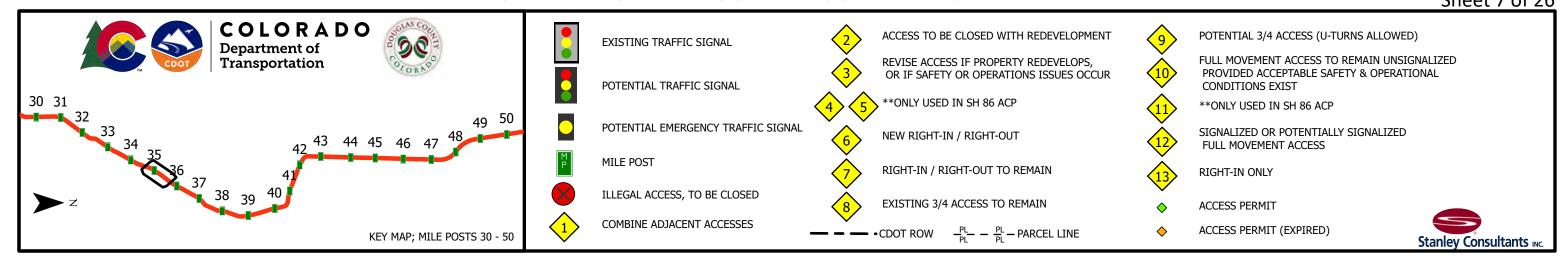





Sheet 8 of 26

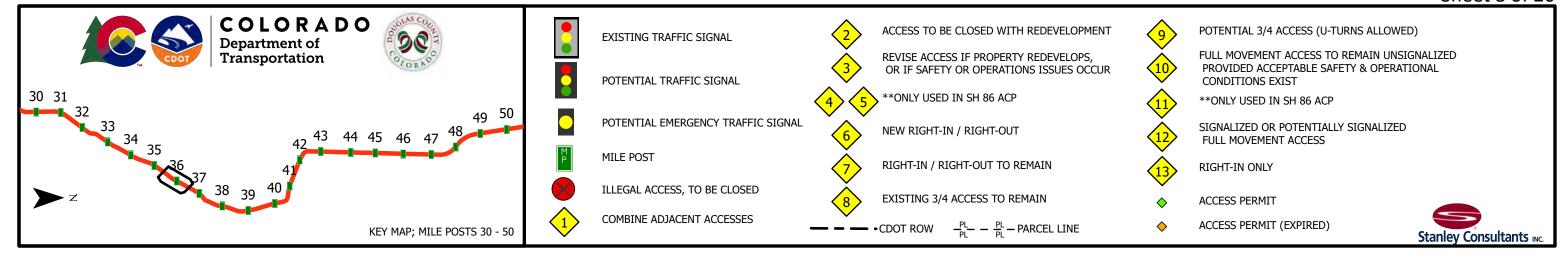

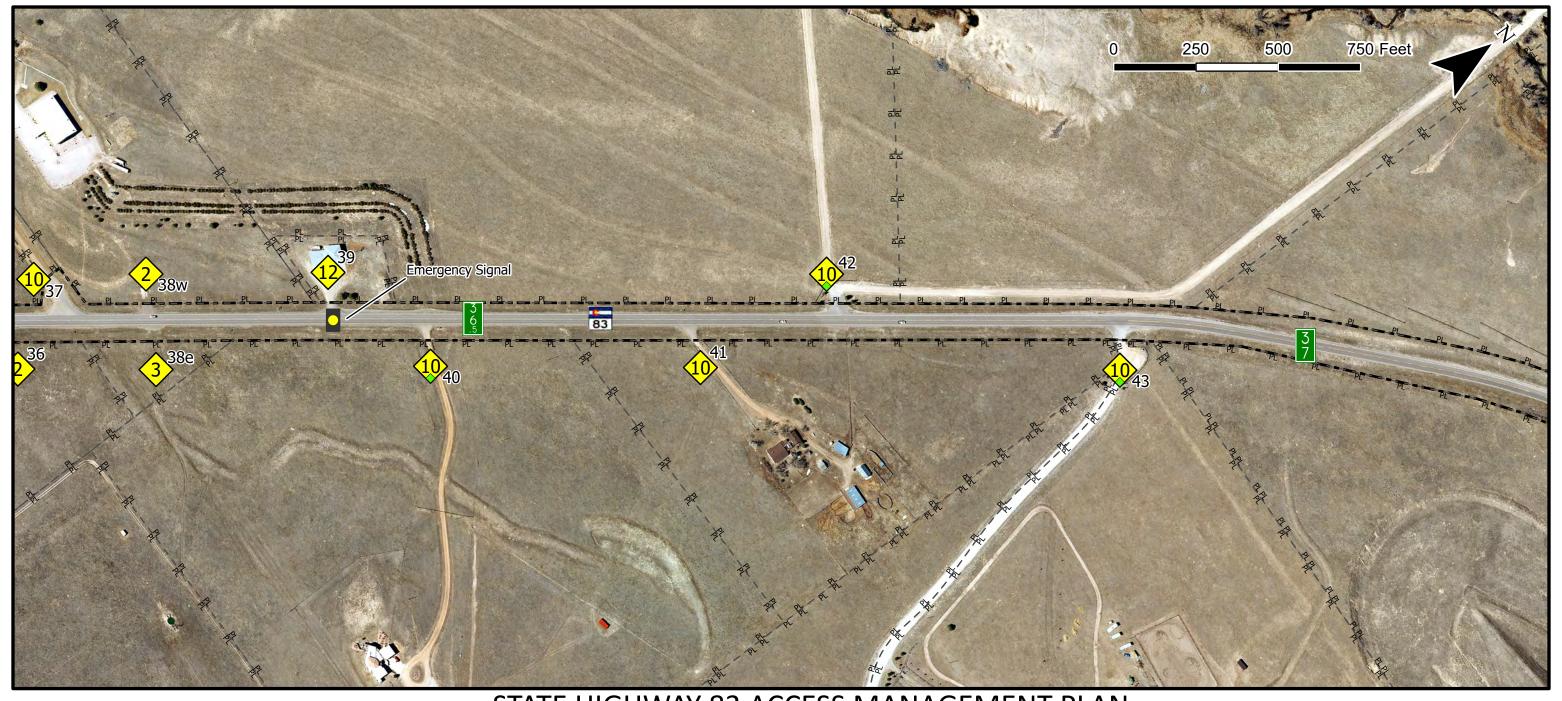


Sheet 9 of 26

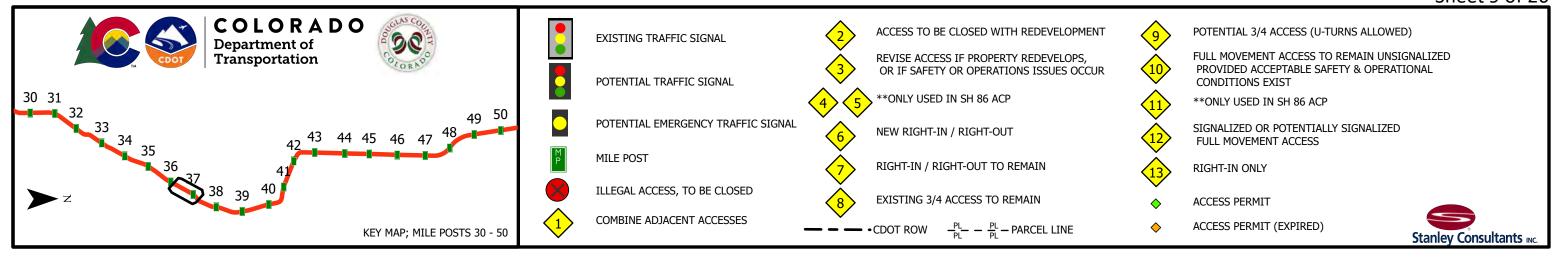

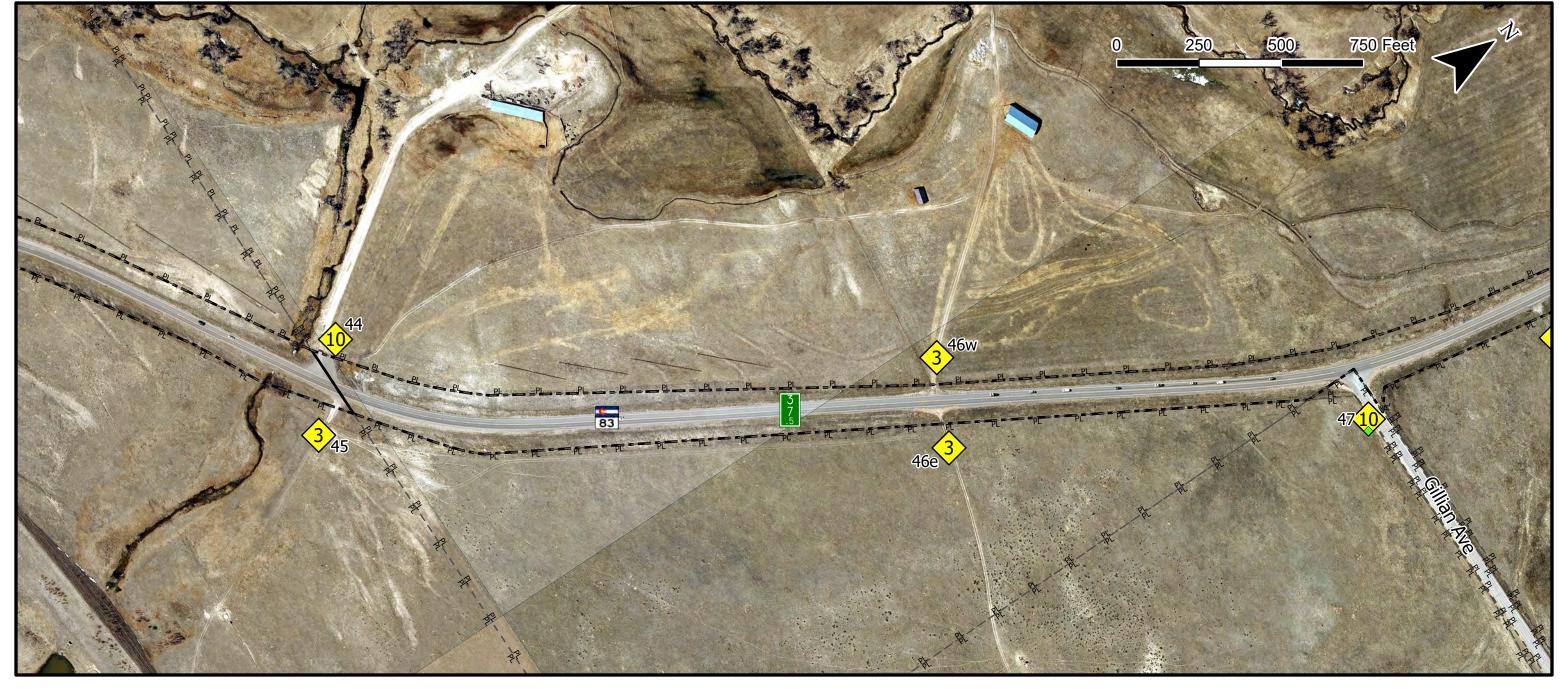


Sheet 10 of 26

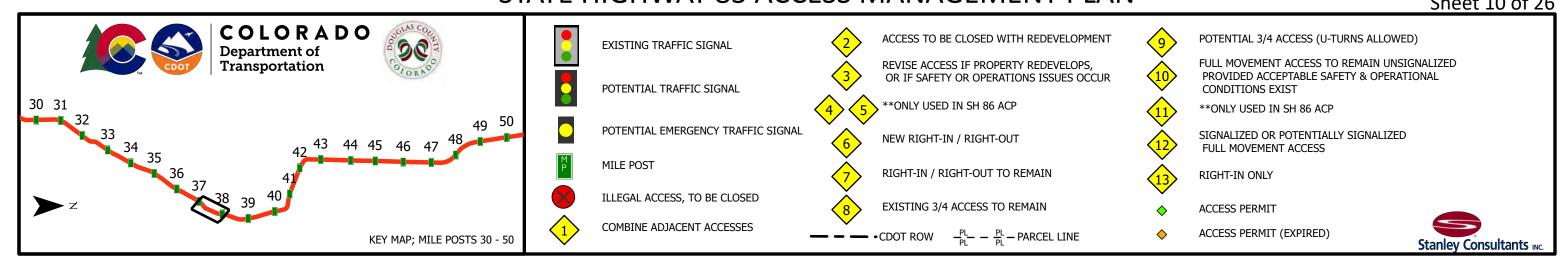




Sheet 11 of 26

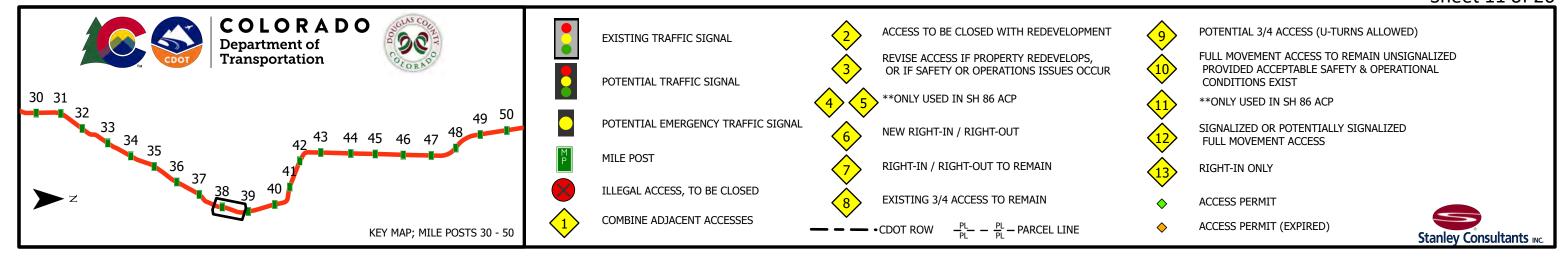





Sheet 12 of 26

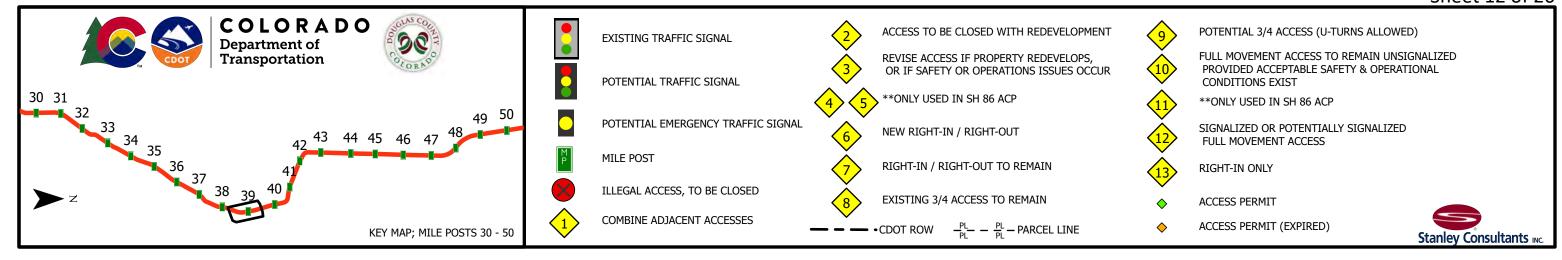





Sheet 13 of 26

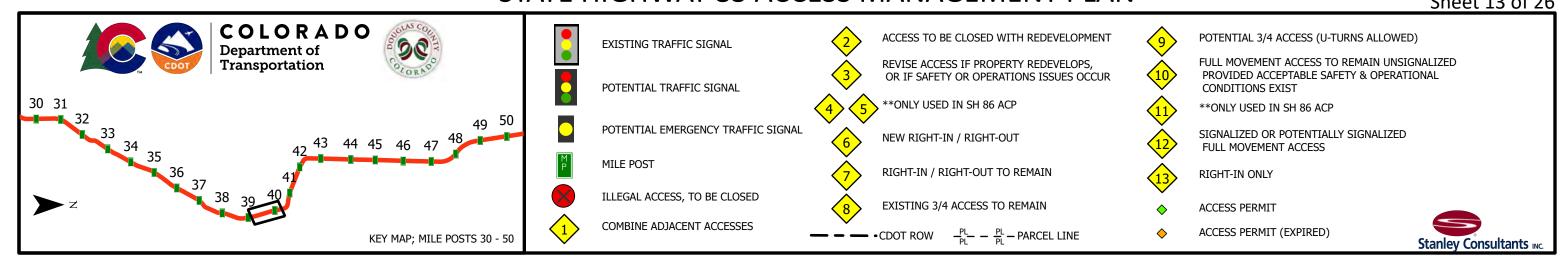

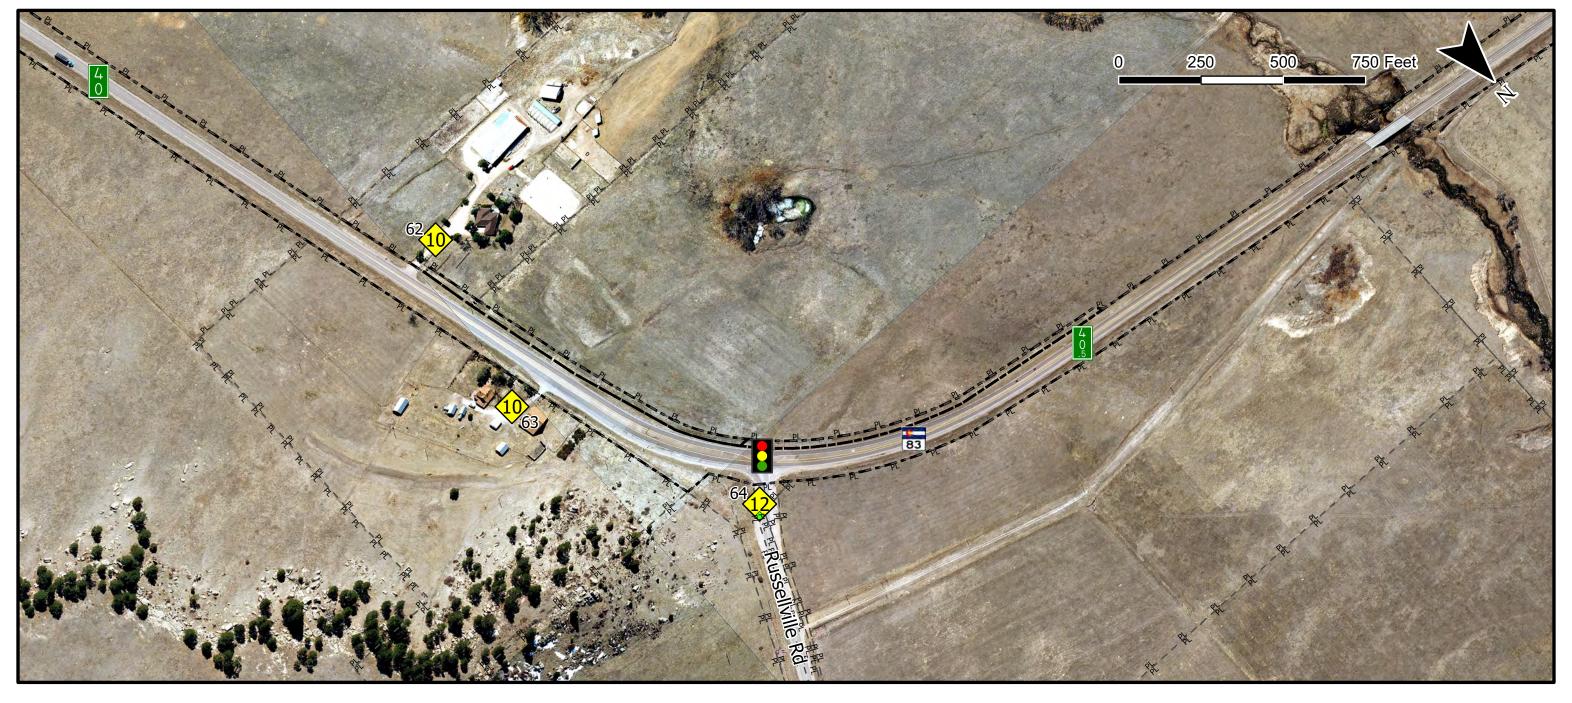



Sheet 14 of 26

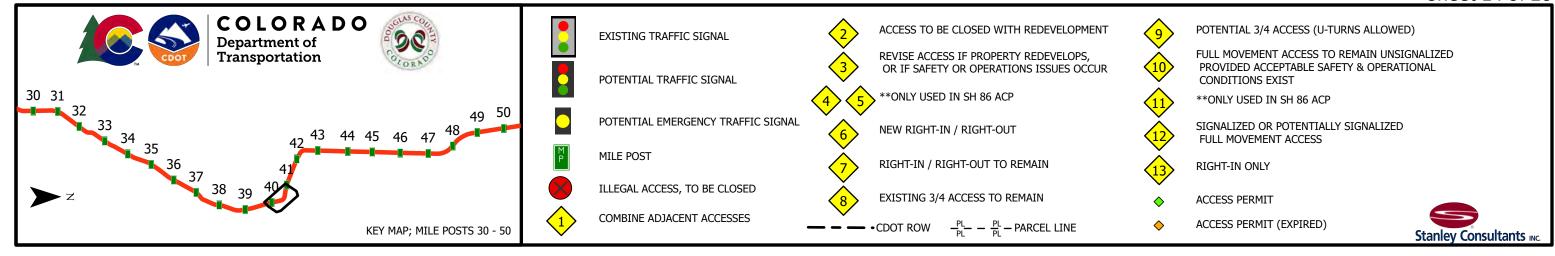

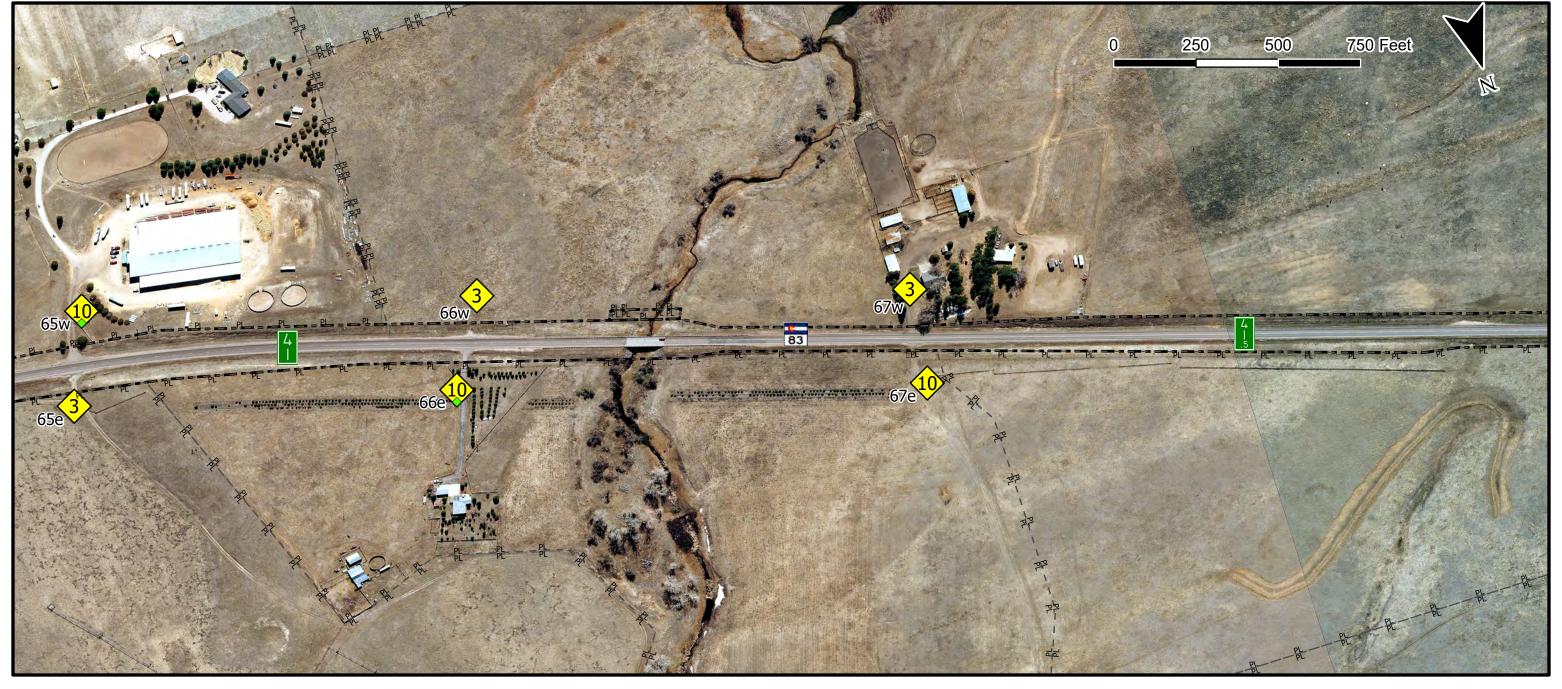



Sheet 15 of 26

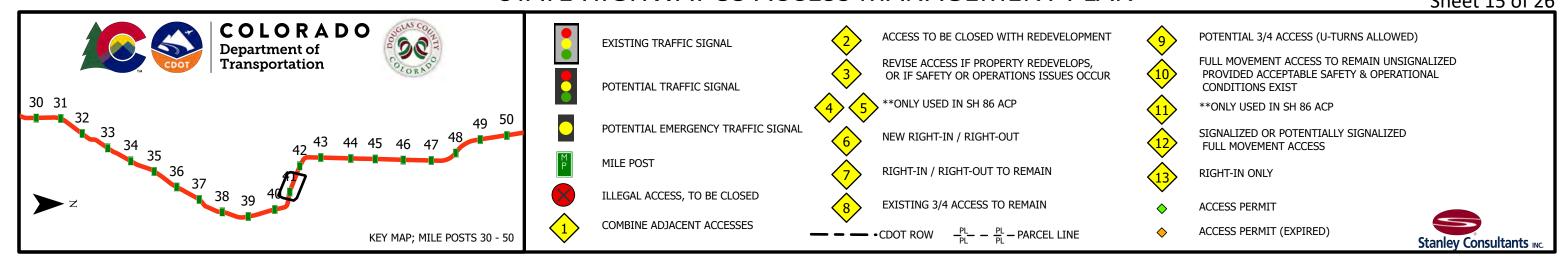

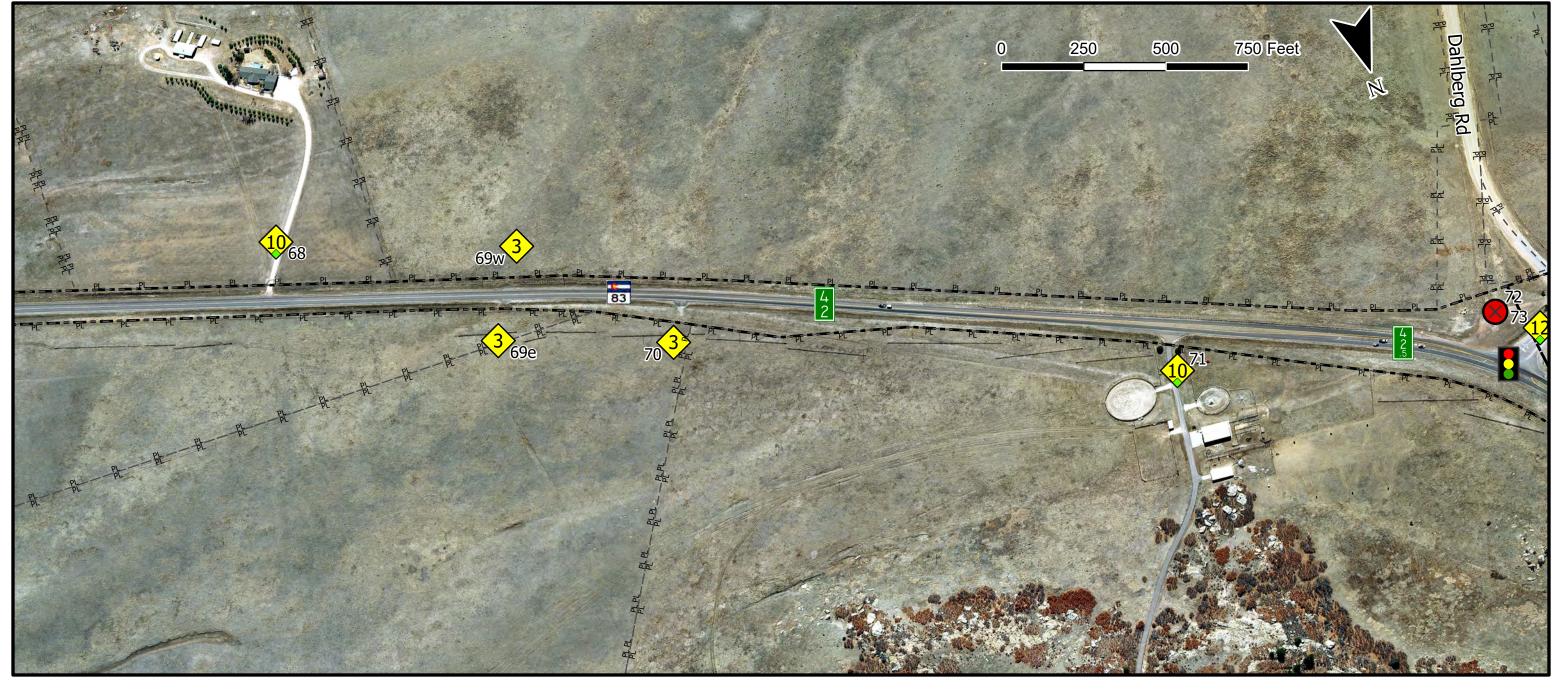


Sheet 16 of 26

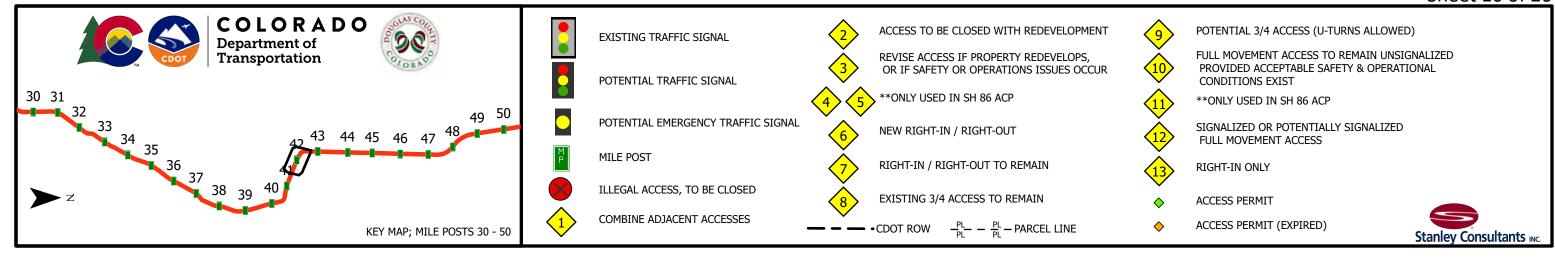

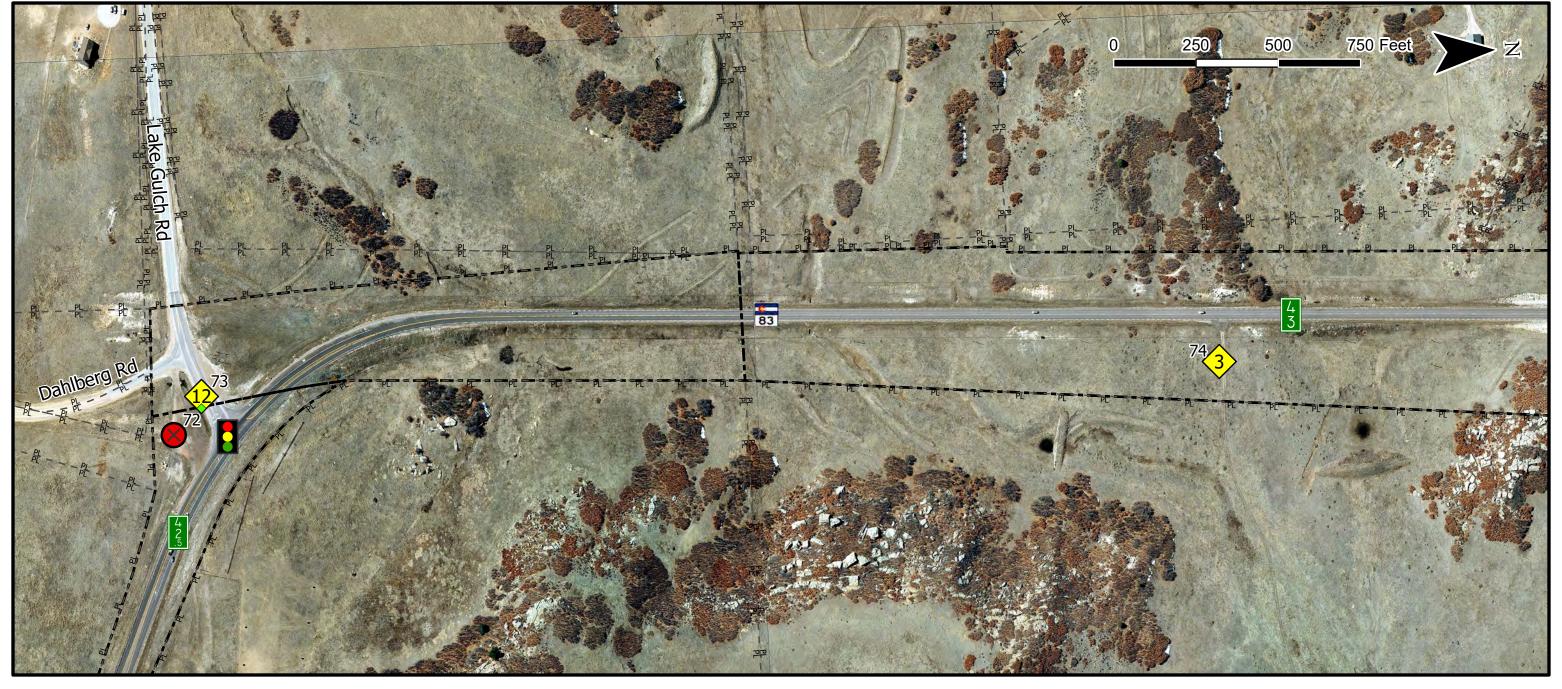



Sheet 17 of 26

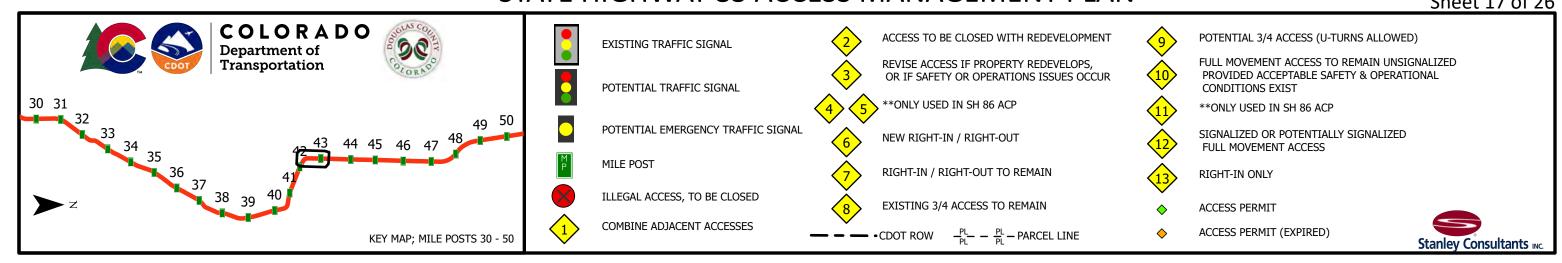





Sheet 18 of 26

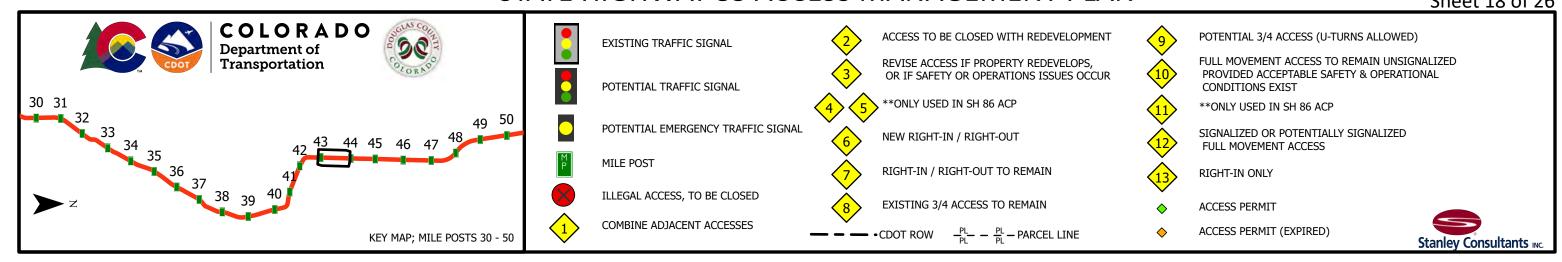

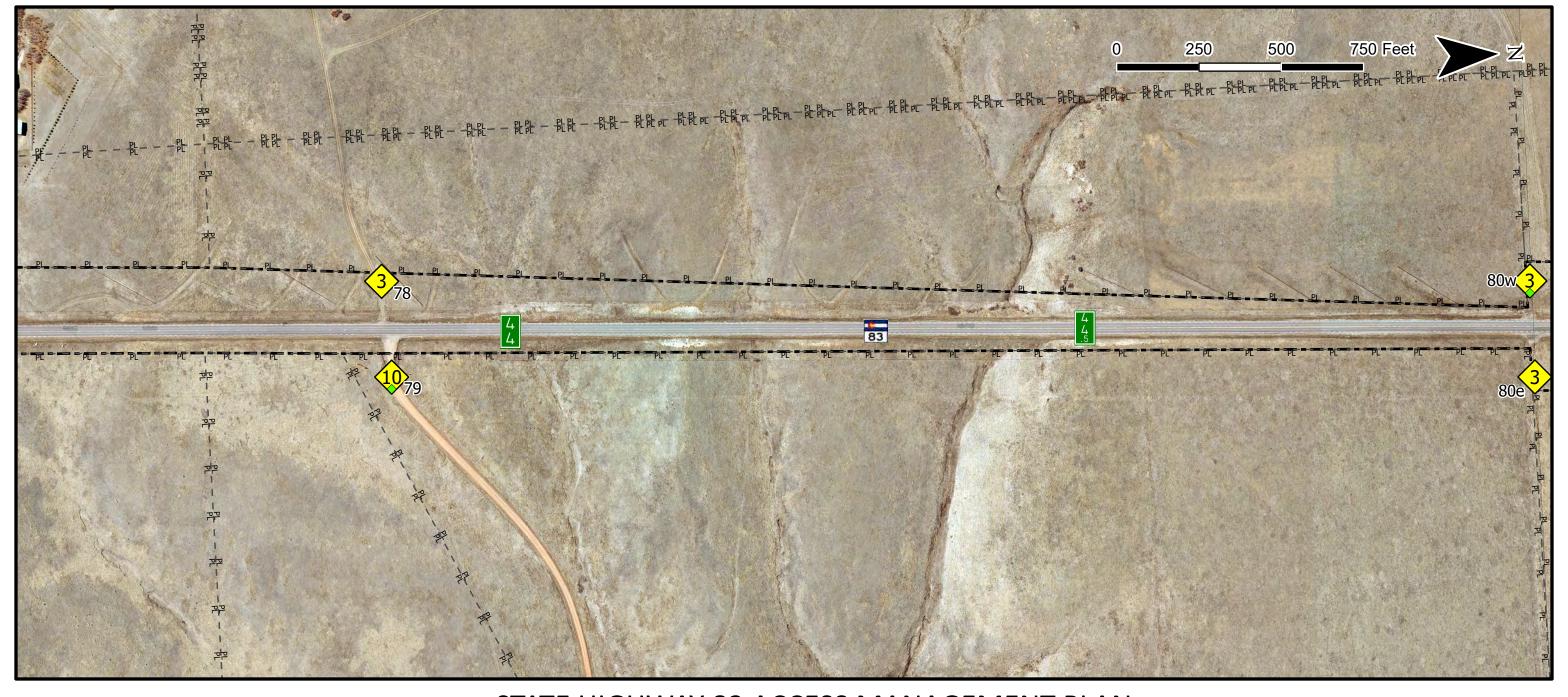



Sheet 19 of 26

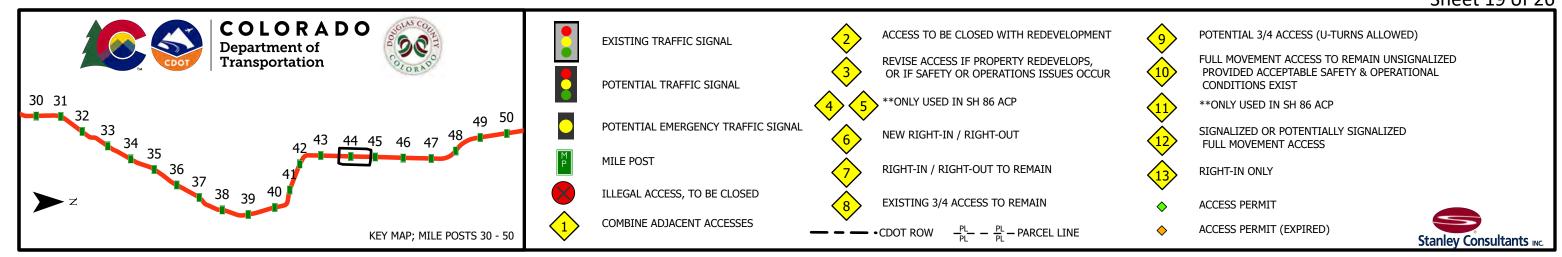

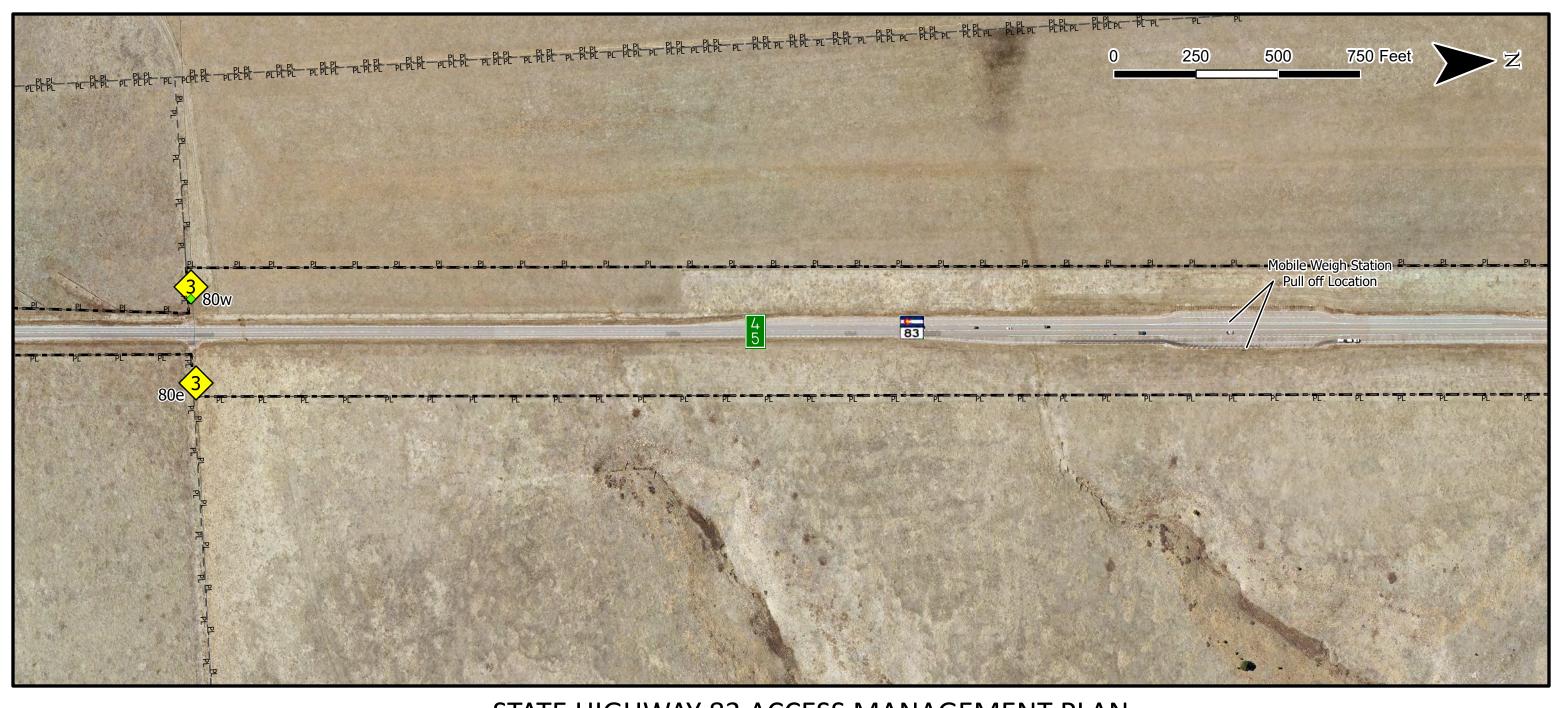



Sheet 20 of 26

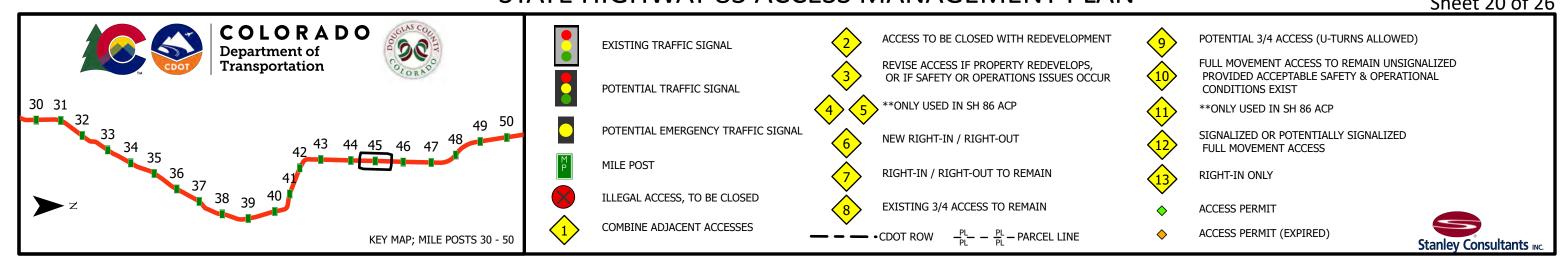

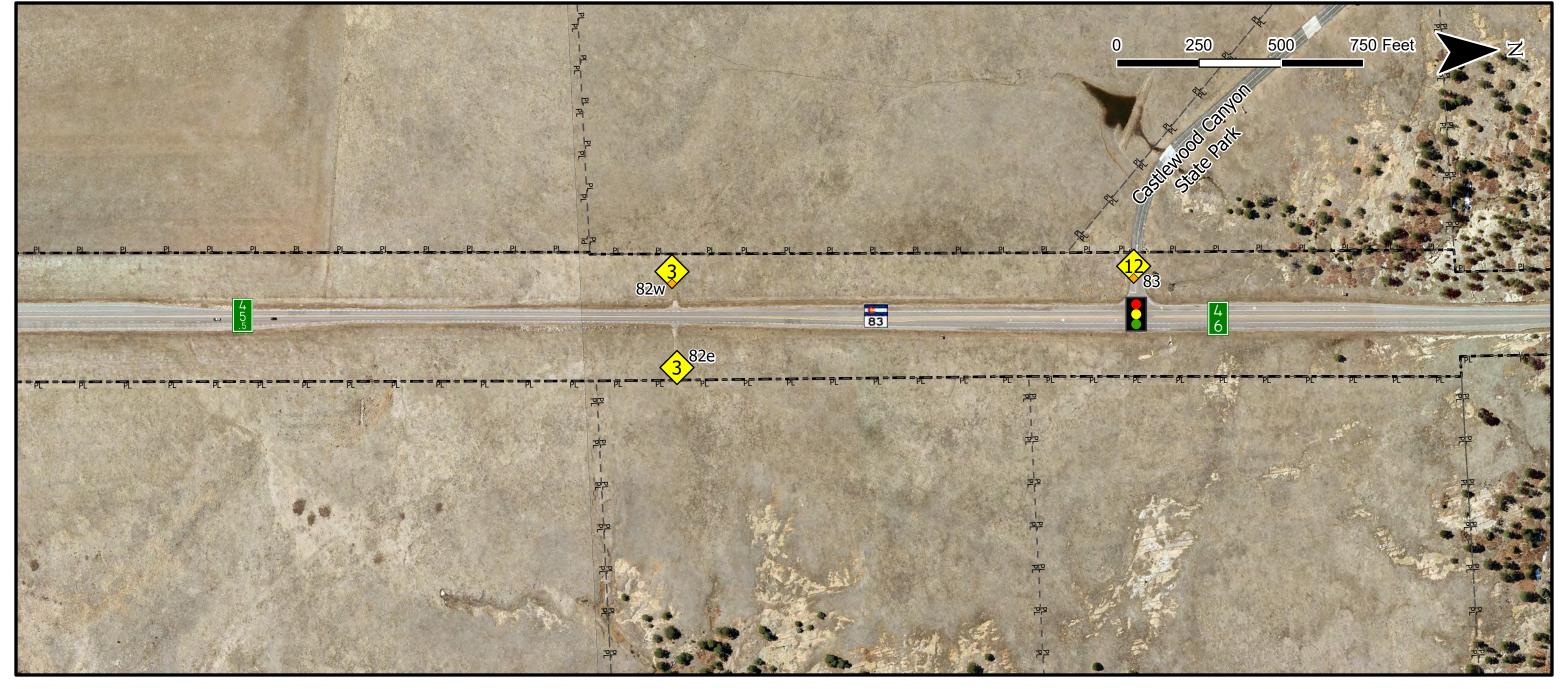



Sheet 21 of 26

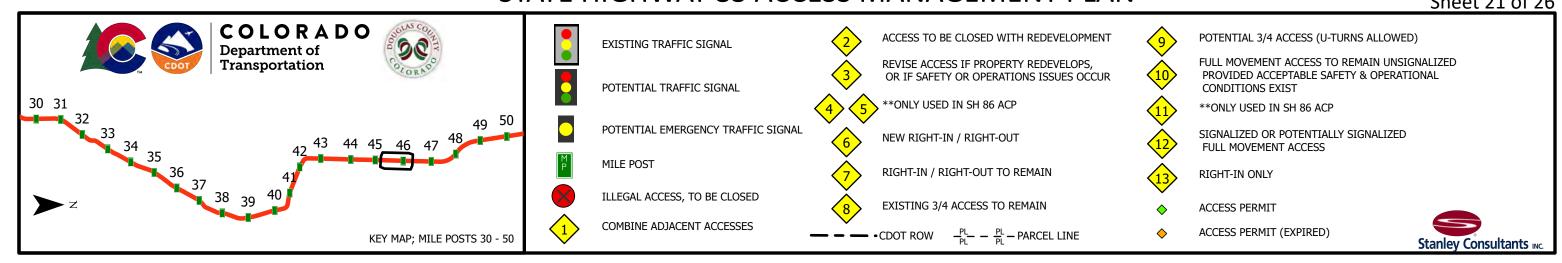

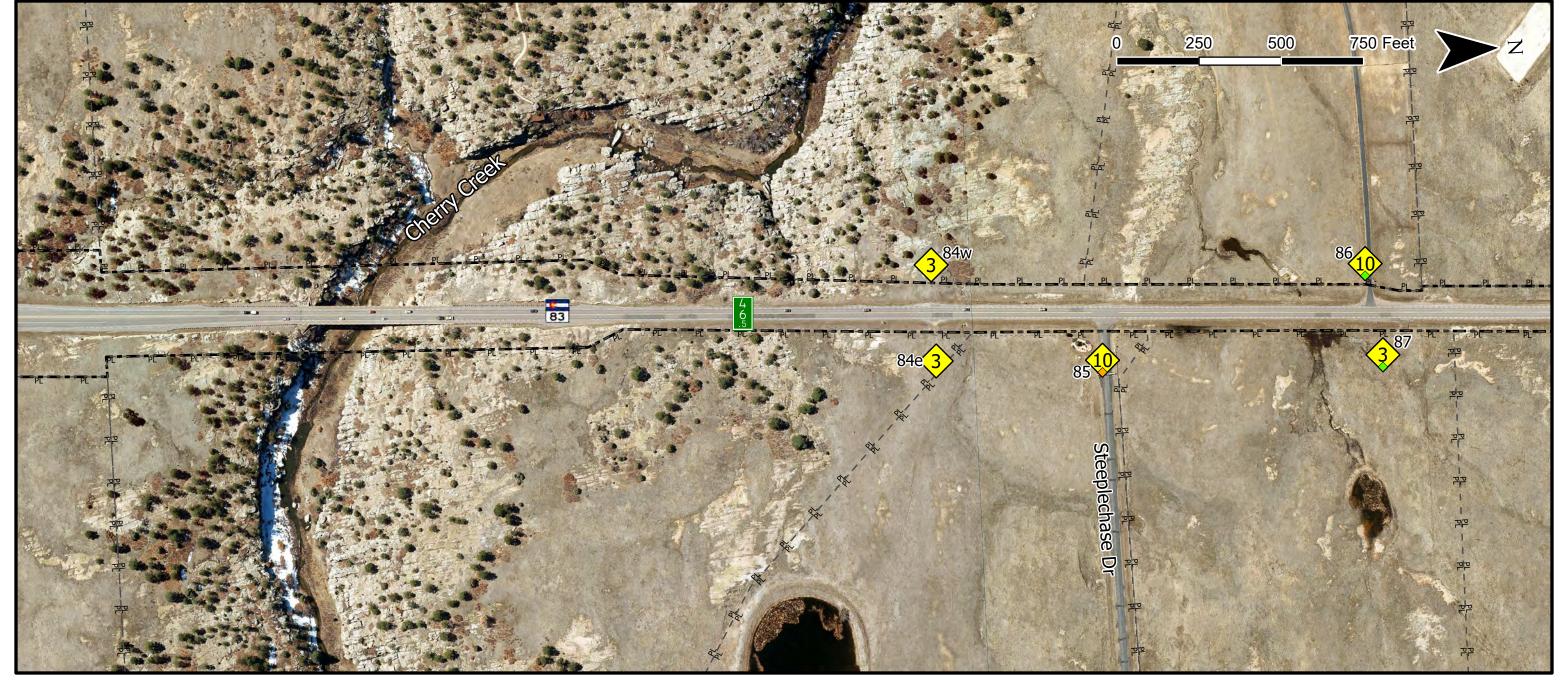



Sheet 22 of 26

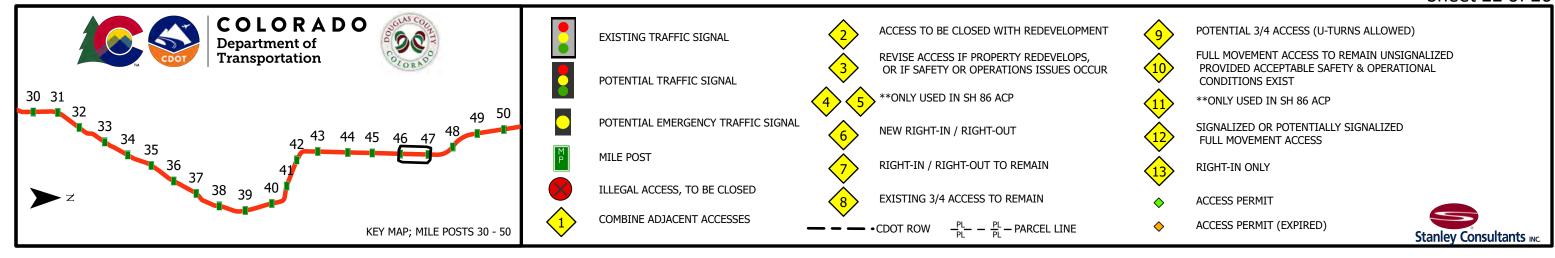

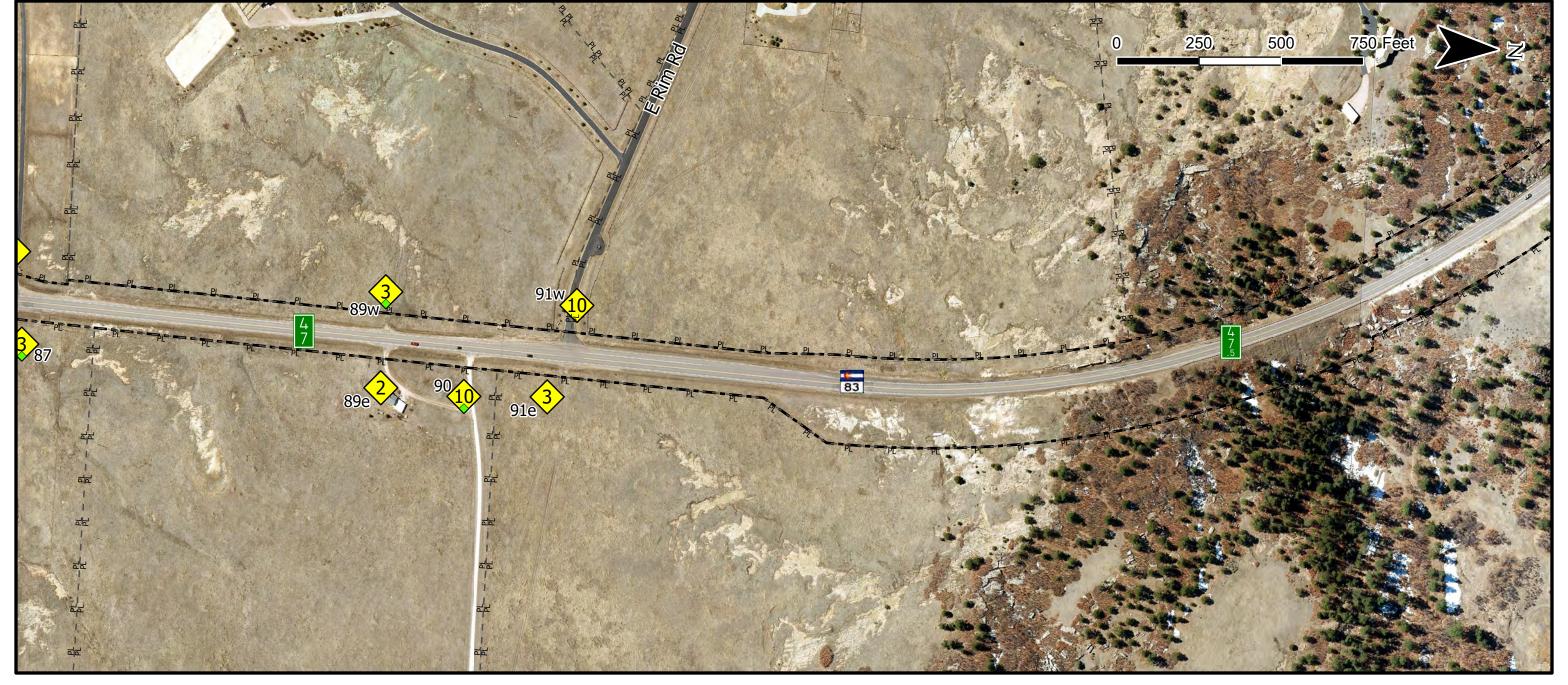



Sheet 23 of 26

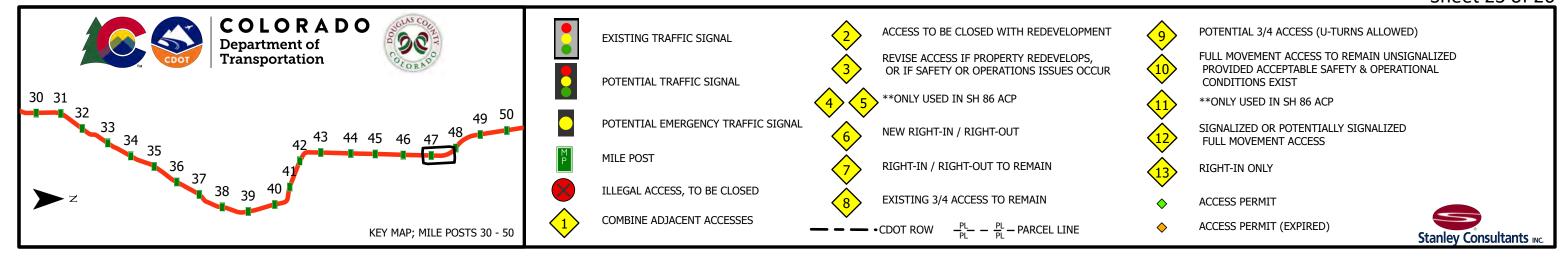

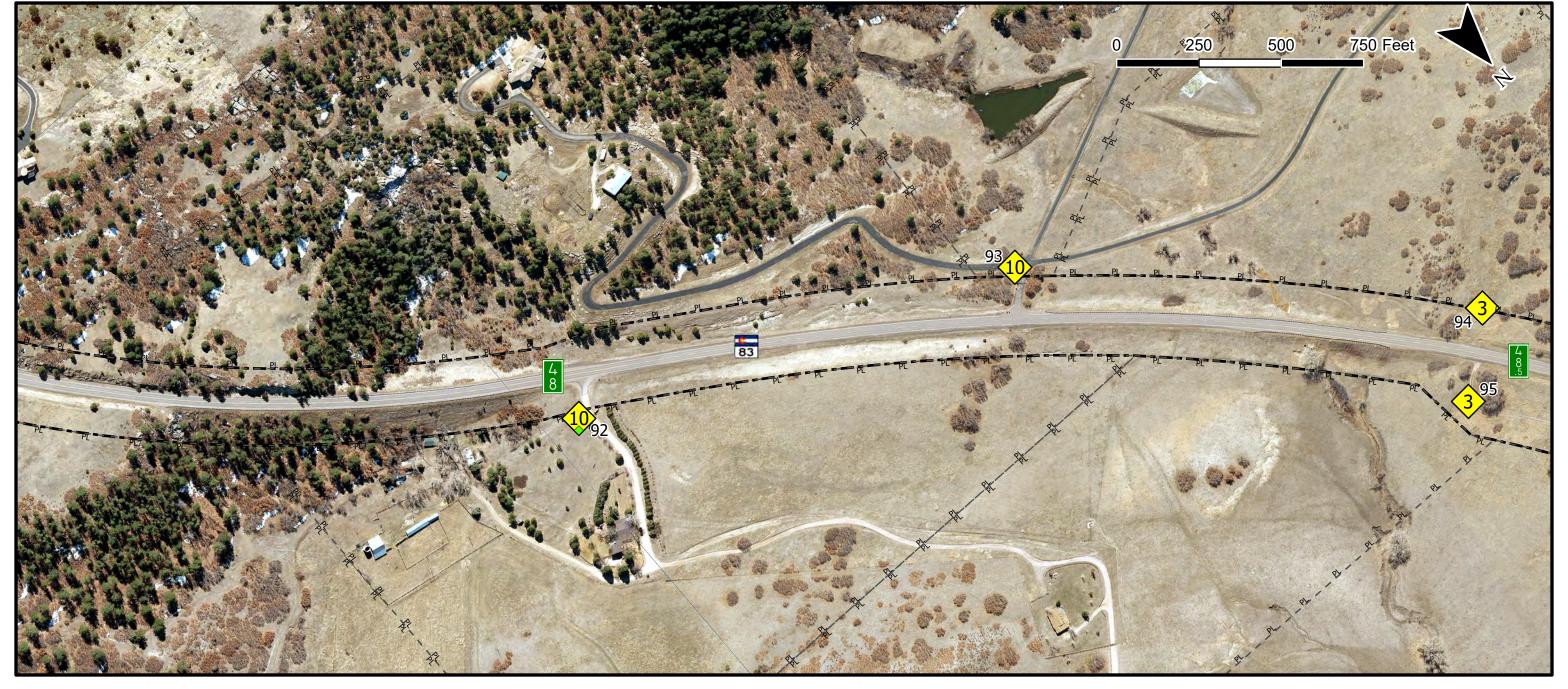


Sheet 24 of 26

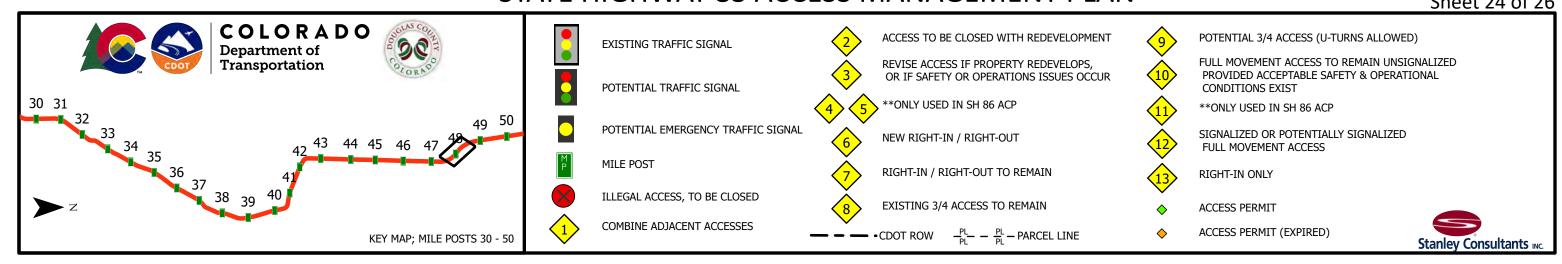

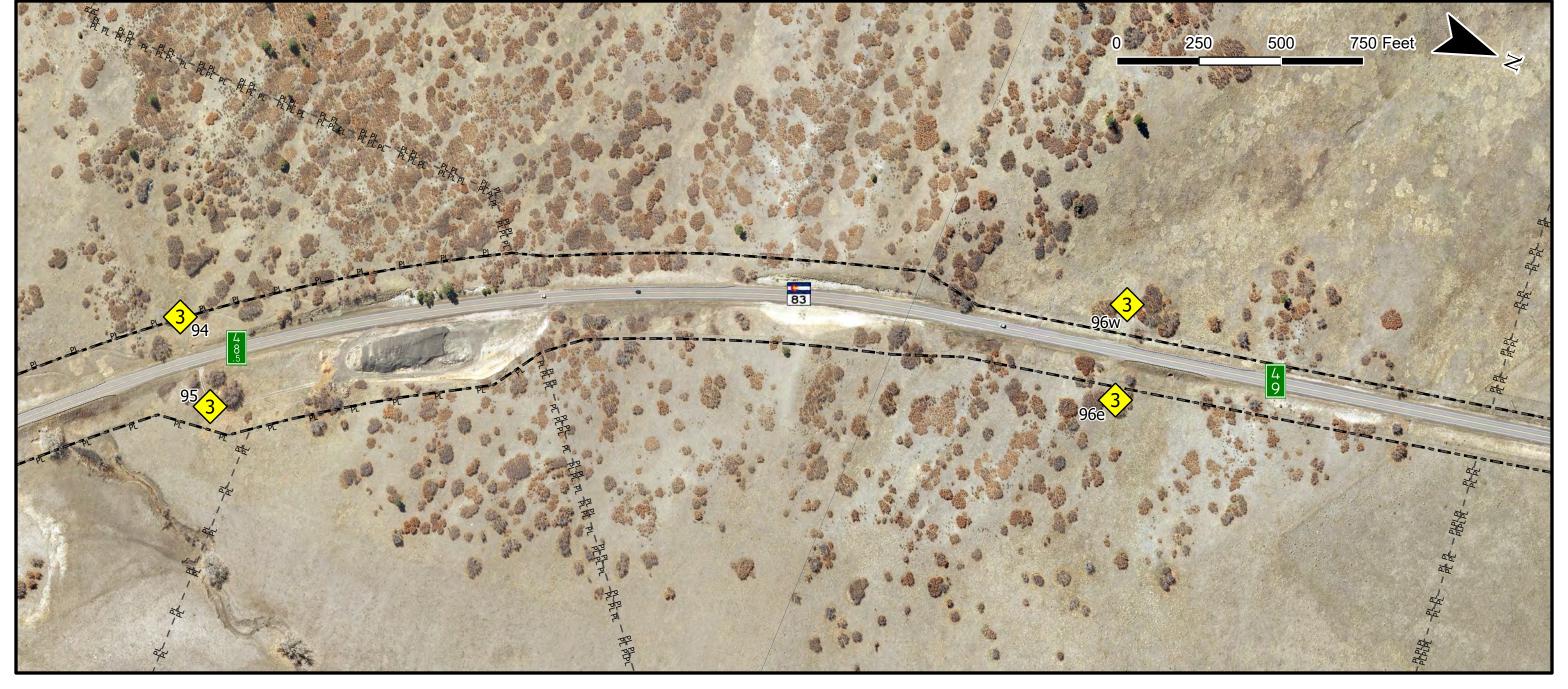

Sheet 25 of 26

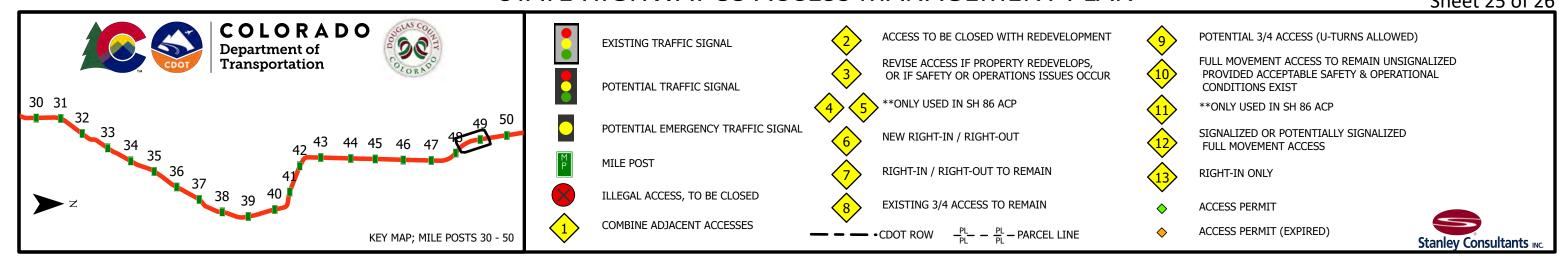



Sheet 26 of 26

